

Horizontal Machining Center

HMSERIES

HM 400 HM 5100 HM 630 HM 800

HMIOOO

HM5005 HM60005

HM8005

HMIOOOS

HMI2505



Horizontal Machining Centers

HM-series horizontal machining centers are built with OKK's exceptional designs and provided with superior performance ensuring high-speed machining, rigidity, reliability, and chip evacuation. Heavy cutting capability is just one of HM-series specialties achieved by incorporating a highly developed rigid box-shaped frame.

Add to that the implementation of only the best in high-speed motors, and extremely reliable ATC's (auto tool changer) and APC's (auto pallet changer) that deliver minimal chip to chip time, truly merging max performance with production proven reliability.



HM 400 HM 5005


Main specifications

HM400/40, HM400/50

Travel X x Y x Z mm (in) =630 (24.80)x620 (24.41)x710 (27.95) Rapid traverse rate m/min (ipm)=54 (2,126) Pallet size square mm (in) =400 (15.75)

HM500S/40, HM500S/50

Travel X x Y x Z mm (in) =630 (24.80)x620 (24.41)x710 (27.95) Rapid traverse rate m/min (ipm)=54 (2,126) Pallet size square mm (in) =500 (19.69) */40:BT40 type, /50:BT40 type

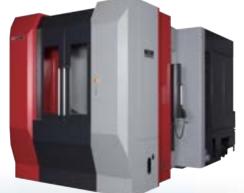

HM5100 HM60005

Main specifications HM5100

Travel X x Y x Z mm (in) =800 (31.50) x 750 (29.53) x 880 (34.65) Rapid traverse rate m/min (ipm) = [Std] XZ: 75 (2953), Y: 60 (2362) Pallet size square mm (in) =500 (19.69) **HM6000S**

Travel X x Y x Z mm (in) =800 (31.50) x 750 (29.53) x 880 (34.65) Rapid traverse rate m/min (ipm) = [Std] XZ: 75 (2953), Y: 60 (2362) Pallet size square mm (in) =630 (24.8)





Main specifications

HM630

Travel X x Y x Z mm (in)=1050 (41.34) x 900 (35.43) x 900 (35.43) Rapid traverse rate m/min (ipm) = [Std] 54 (2126) = [Opt] 75 (2953)

Pallet size square mm (in) = 630 (24.8)

Travel X x Y x Z mm (in)=1050 (41.34) x 900 (35.43) x 880 (34.65) Rapid traverse rate m/min (ipm) = [Std] 54 (2126) = [Opt] 75 (2953)

Pallet size square mm (in)= 800 (31.5)



HM 800 HM 10005

Main specifications

HM800

Travel X x Y x Z mm (in) =1400(55.12)x1100(43.31)x1050(41.34) Rapid traverse rate m/min (ipm) = 48(1889) Pallet size square mm (in) =800(31.5) **HM1000S**

Travel X x Y x Z mm (in) =1400(55.12)x1100(43.31)x1000(39.37) Rapid traverse rate m/min (ipm) = 48(1889) Pallet size square mm (in) =1000(39.37)

HM1000 HM12505

Main specifications

HM1000

Travel X x Y x Z mm (in) =1700(66.93)x1400(55.12)x1400(55.12) Rapid traverse rate m/min (ipm) = 48(1889) Pallet size square mm (in) =1000(39.37)

HM1250S

Travel X x Y x Z mm (in) =1700(66.93)x1400(55.12)x1240(48.82) Rapid traverse rate m/min (ipm) = 48(1889) Pallet size square mm (in) =1250(49.21)

P01

[Std] Standard equipment or function [Opt] Optional equipment or function

Main features

Mail leatares	101
Features	P03
Chip disposal	06
High speed and heavy-duty cutting .	07
Spindle power and	
torque diagram	09
Pallet table and APC	11
High precision structure.	12
Tool magazine	13

C () N '	ΤE	ΝT	S

OKK

ATC(Automatic tool changer)	15
Powerful feeding	16
Accuracy	17
Cutting capacity	18
Operations	19
Maintenance	20
Standard and option list.	21
Option	P 22
Software	29

Controller	P 31
F31i-B	31
FAi	32
Specifications	P33
HM400/HM500S	33
HM5100/HM6000S	35
HM630/HM800S	37
HM800/HM1000S	39
HM1000/HM1250S	41

HM400/HM5005

With more rigid construction than conventional models, responding to the needs to machining a wide range of products from iron and cast iron to mold and die parts.

Not only the rigidity but also spindle speed, rapid traverse, reliability and machining performance have been upgraded.

HM400/40 and HM500S/40 models come equipped with a 10000min⁻¹ spindle, with an output of 37/26/22kW (50/35/30HP) available in BT40 spindle taper, as well as the option for a 15000min⁻¹ or 20000min⁻¹ spindle. HM400/50 and HM500S/50 models have a standard spindle reaching 12000 min⁻¹, with an output of 30/25kW (40/34HP) available in BT50 spindle taper, with an optional 8000min⁻¹. Allows customers the best option for the job.

The unique clamp construction provides excellent sealing performance by clamping while increasing the internal pressure of the table, thus preventing the infiltration of coolant enhancing the durability of the machines.





High rigid linear roller guides are used for all axes of X, Y and Z.

The ball screws are core-cooled ball screws and pre tensioned by double-anchor method. Cooling oil is forced to all ball screws, ball screw support housings and motor mounting surfaces.

The fine-feed movement and the lost motion property have been improved. The circular cutting accuracy is also improved significantly.

Characteristics

- * The machining time is significantly improved by increasing all of speeds.
- * The ball screws are core-cooled ball screws and double anchored.
- * Option of a BT40 is with 10000 min⁻¹ or BT50 with 12000 min⁻¹ is available to meet your machining needs.
- * One piece shutters are used for X and Z axes and avoids chips and coolant going to inside.

(only Z-axis shutter is one piece type for HM400/50 and HM500S/50.)

HM5100/HM60005 HM630/HM8005 HM800/HM10005

Double the speed, rigidity, reliability, durability, etc. compared with the conventional machines enable high-speed and high-accuracy machining of wide-ranging materials including hard-to-cut materials such as ferrous and casting materials.


In addition to the high rigidity of the machine main unit, highly-rigid linear roller guides on the X, Y and Z axes generate a synergetic effect and improve further the cutting performance.

Increase in the rapid-traverse rates, ATC speed, table turning speed and APC speed has shortened the non-cutting time and improved production efficiency.

For the improved heavy-duty cutting performance, the machine has a BT50 large-diameter ø100mm (3.94") spindle and a 45/30/26kW (60/40/35HP) high-power motor.



Built - in - Rotary Table (BRT) use a new mechanism of precision reduction-gear roller drive. This drive system achieved high speed table indexing and toughness against overload or impact. ^{*1}

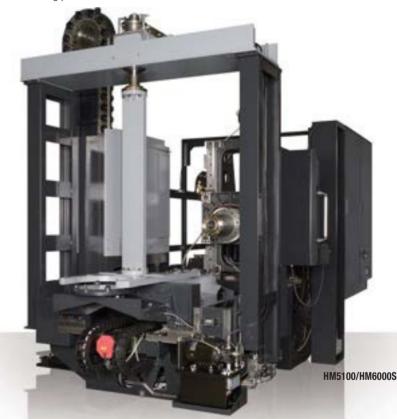

to the state

Pallet positioning and clamping

Use of taper cones ensures high accurate repeatability of pallet positioning and flatness of the pallet is secured by means of OKK's original design multiple-clamp method."²

Master pallet is available as option.*3

Characteristics

- * Linear roller guides are capable the six times more moment load than a conventional model.
- * BRT use the high speed and high rigid reduction-gear roller drive that is more than double the rigidity and clamping torque compared to a conventional model. *1

Specificatio	ns	Spindle speed (min-1)	Type of tool shank	Spindle bearing inner diameter (mm)	Rapid traverse rate (m/min)
HM5100/HM60	A6000S	12000			75 (2953 ipm)*5
HM630/HM80)0S	12000	BT50	ø100 (3.94")	54 (2126 ipm) [Opt. 75 (2953 ipm)]*5
HM800/HM10	00S	8000			48 (1889 ipm)

*1: HM800/HM1000S and HM1000/HM1250S use worm shaft and worm wheel. *2: HM400/HM500S is using center-clamping method. *3: Master pallet is available only for HM5100/HM6000S.

*4: Additional option available rapid traverse rate to 75m/min(2953ipm) for X-axis and Z-axis. *5: An air tank is necessary to attach a balance cylinder to Y axis. The air tank needs local procurement at machine export.

=eatures

HM1000/HM12505

All HM models are highly effective in machining cast-metal and iron-based work pieces, including construction machinery parts, such as cylinder blocks with massive valves requiring maximum rigidity for custom tooling and large molds.

+++

Adopting twin-ball-screw drives and synchronously control for the Y and Z axes, suppresses vibrations and improves machining quality.

Furthermore for severe heavy-duty cutting, a larger spindle bearing diameter of 120 mm (4.72") with maximum spindle speed of 8000 min⁻¹, high-power spindle motor of 37/30 kW (50/40HP) and high-torque motorized spindle of 1009 N·m (744 ft·lbs) is available as option on HM1000/HM1250S.



- * HM1000 and HM1250S models standard spindle delivers 12000min⁻¹, with a bearing diameter of 100mm (3.94") and 30/25kW (40/34HP), 420N·m (310 ft·lbs) of torque.
- *Twin-ball-screws for both Y-and Z-axes, aiding in vibration dampening yielding extended tool life. The design focus is reduction of machining time, while increasing precision, surface finish, and contouring accuracy.


HM-series are proven in high production machining environments and are ready to cut aluminum to cast metals.



Z axis twin-ball-screw

The Z-axis shutters and B-axis are angled sharply, allowing for excellent chip evacuation. Furthermore, OKK added a solid Y-axis shutter to eliminate any problems previously caused from chips clogging on un-maintained slide rails.


Thorough chip processing measures

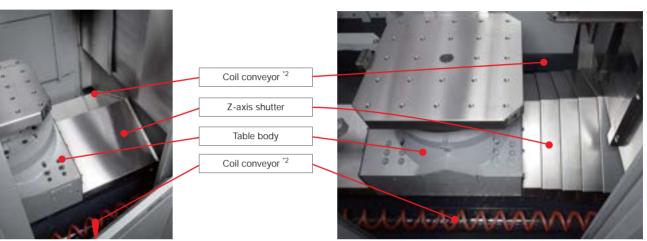

HM400/M500S

HM5100/HM6000S

Chips are flushed so that they fall into the troughs on both sides of the table. Then, the chips are flushed out with coolant supplied though the nozzles provided in the front-end section of each trough. The coolant and chips are collected in the chip tank in the rear part of the machine (Chip flow coolant *1). In place of the standard method that flushes out chips with coolant, you may use optional coil-type chip conveyor *2 to clear the troughs and to discharge chips through the outlet in the rear part of the machine.

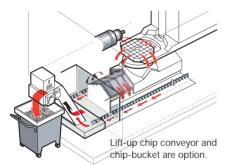



The troughs are extended and chips at the setup station can be collected



Chip flow coolant *1

Chips are discharged from the troughs to outside of machine by big volume of coolant.

Ceiling shower [Opt]*3

*1: Standard for HM400/HM500S, HM800/HM1000S.

*2: Standard for HM5100/HM6000S, HM630/800S, HM1000/HM1250S

Coolant through nozzles on the ceiling i.e. ceiling shower can be provided optionally for prevention of chips from accumulating on fixtures and workpieces. *3: Standard for HM5100/HM6000S



HM630/HM800S

26 nozzles for HM400/HM500S 50 nozzles for HM800/HM1000S 27 nozzles for HM5100/HM6000S 91 nozzles for HM1000/HM1250S 30 nozzles for HM630/HM800S

+++

HM1000/HM1250S

HM400/HM500S

HM Series

High Speed and Heavy-duty Cutting




HM400/HM500Ss'

standard spindle specification is motorized spindle, maximum speed 10,000min⁻¹ with grease lubrication, BT40 and 37/26/22kW (50/35/30HP). Optional spindles 15,000min⁻¹ and 20,000min⁻¹ are oil-air lubrication.


Cutting data		
Machine model	HM400/40	
Material	S50C	
Tool	ø32 mm (1.26") Long end milling	
Length of the tool from tool holder nose	130 mm (5.12")	
Spindle speed	1300 min ⁻¹	
Feed rate	6500 mm/min (256 ipm)	
Depth of cut	0.5 mm (0.02")	
Width of cut	20 mm (0.79")	

Spindle Cooling

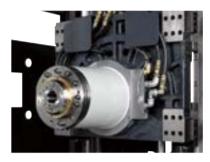

Circulating the temperature-controlled oil around the spindle housing minimize the spindle temperature fluctuation.

MS: Motorized spindle

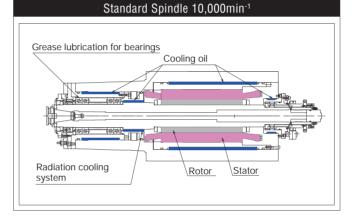




The BT50 spindle rotating at 12000 min⁻¹ secures the 45/30/26kW (60/40/35HP) output. For the bearing lubrication, the machine uses the oil-air lubrication. The spindle specification can be selected according to the details of machining.

Spindle Cooling



The spindle bearings are oil-air lubricated. Circulating temperature controlled oil is in the groove around the spindle housing suppressing the growth of the spindle. Furthermore, OKK's unique radiant cooling system prevents the conduction of heat generated from the motor into the spindle.

Standard Spindle 12,000min⁻¹

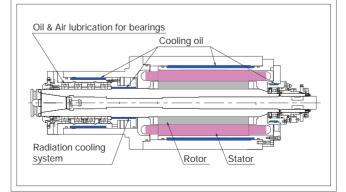

Cutting data

Machine model	HM630	
Material	S50C	
Tool	ø80 mm (3.15") High feed end mill	
Spindle speed	600 min ⁻¹	
Feed rate	4000 mm/min (157.48 ipm)	
Depth of cut	1 mm (0.04")	
Width of cut	80 mm (3.15")	

The standard spindle used for **HM800/HM1000S** is the BT50 spindle having the output of 30/25 kW (40/34 HP) and rotating at 8000 min⁻¹. The maximum torque of 420 N·m (310 ft·lbs) can provide high power in the low-speed range.Both the heavy-duty cutting and the high-speed machining are available owing to the highly-rigid spindle with \emptyset 100mm (3.94") spindle bearing inner diameter and the oil-air lubrication system.

Cutting data		
Machine model	HM1000S	
Material	Mold steel (SKD61)	
Tool	ø80mm (3.15") End milling	
Length of the tool from tool holder nose	200mm (7.87")	
Spindle speed	1600mm ⁻¹	
Feed rate	1920mm/min (75.6in/min)	
Depth of cut 4.0mm (0.16")		
Width of cut	60.0mm (2.36")	




×.

HM630 / HM800S and HM800 / HM1000S Gear-drive spindle [Opt]

Max. torque: 1251N · m (923ft · lbs)

As an option to deliver more torque for machining of hard-to-cut materials, an 8000min⁻¹ high torque gear-drive spindle produces 1251 N·m (923 ft·lbs). Available on HM630/HM800S and HM800/HM1000S.

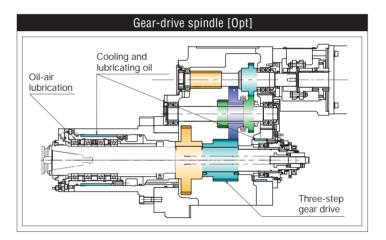

Power of tool clamp

MS spindle			
Machine model	Spindle speed 10000min ⁻¹	Spindle speed 15000min ⁻¹	Spindle speed 20000min ⁻¹
HM400/40, HM500S/40	10000N (2200lbf)	10000N (2200lbf) [Opt]	10000N (2200lbf) [Opt]


MS spindle			
Machine model	Spindle speed 12000min ⁻¹	Spindle speed 8000min ⁻¹	
HM400/50, HM500S/50	16300N (3700lbf)	16300N (3700lbf) [Opt]	
HM5100/HM6000S	16300N (3700lbf)	—	
HM630/HM800S	16300N (3700lbf)	16300N (3700lbf) [Opt]	
HM800/HM1000S	16300N (3700lbf) [Opt]	17700N (4000lbf)	
HM1000/HM1250S	16300N (3700lbf)	20600N (4600lbf) [Opt]	

Gear spindle	
Machine model Spindle speed 8000min ⁻¹	
HM630/HM800S 19600N (4400lbf) [Opt]	
HM800/HM1000S	19600N (4400lbf) [Opt]




HM Series


FANUC / #40

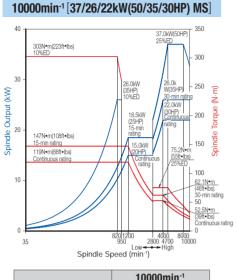

	1000011111
Spindle motor	37/26/22kW(50/35/30HP) MS
HM400/40, HM500S/40	Standard

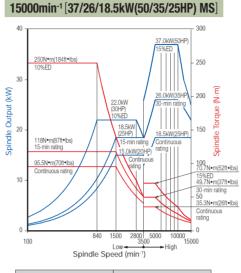


	15000min ⁻¹		
Spindle motor	37/26/18.5kW(50/35/25HP) MS		
HM400/40, HM500S/40	Option		

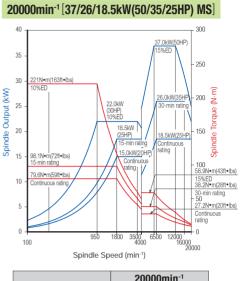

	2000011111	
Spindle motor	37/26/18.5kW(50/35/25HP) MS	
HM400/40, HM 500S/40	Option	


FANUC / #50

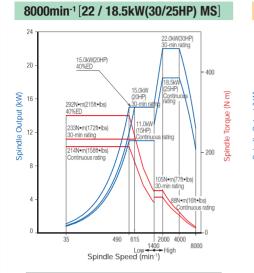

8000min ⁻¹					
Spindle motor 22/18.5kW(30/25HP) MS					
HM400/50, HM500S/50	Option				
HM5100/HM6000S	—				
HM630/HM800S	—				
HM800/HM1000S	—				
HM1000/HM1250S	—				

-: not available

8000min⁻¹[22 / 18.5kW(30/25HP) Gear]

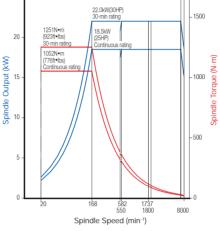

8000min ⁻¹				
Spindle motor 22/18.5kW(30/25HP) Gear				
HM400/50, HM500S/50	—			
HM5100/HM6000S –				
HM630/HM800S	Option			
HM800/HM1000S	Option			
HM1000/HM1250S	—			

-: not available

- 250

- 200

- 150

ating

50

10000 12000

5.0kW(20HP)

95N•n . 100

ontinuòus r

115N•m

1500 2500 2000 High

30/25kW(40/34HP) MS

Standard

_


Option

Standard

Spindle

8000min⁻¹ [30 / 25kW(40/34HP) MS]

2++++

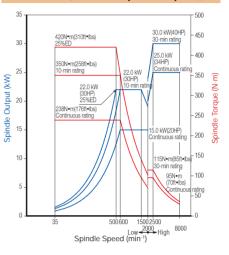

8000min ⁻¹			
30/25kW(40/34HP) MS			
_			
—			
_			
Standard			
_			


-: not available

12000min⁻¹[45/30/26kW(60/40/35HP) MS] 50 700 45kW (60HP) 623N•m (460ft•lbs) 15%ED 45 600 40 512N•m (378ft•lbs) 25%ED 30kW (40HP) 15%ED 500 35 30kW (40HP) Torque (N-m) 30-mir rating 382N•m (282ft•lbs) 30min rating 26kW (35HP) 400 305N•m (225ft•lbs) ating Spindle cont.rating 300 153N•m (113ft•lbs 25%ED 26kW (35HP) 25%ED 25%ED 22kW (30HP) 30-min rating 18.5kW (25HI Continuous.ra 15 115N•m 85ft•lbs) 200 30min ra 10 100 5 0 900 2800 13002000 4000 2500 Low 12000

Spindle Speed (min⁻¹) 580 Low-

12000min ⁻¹				
Spindle motor 45/30/26kW(60/40/35HP) N				
HM400/50, HM500S/50	—			
HM5100/HM6000S	Standard			
HM630/HM800S	Standard			
HM800/HM1000S Option				
HM1000/HM1250S Option				

8000min⁻¹[37 / 30kW(50/40HP) MS]

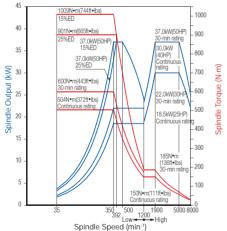

8000min ⁻¹			
Spindle motor 37/30kW(50/40HP) M			
HM400/50, HM500S/50	_		
HM5100/HM6000S -			
HM630/HM800S –			
HM800/HM1000S	_		
HM1000/HM1250S Option			
	— Option		

-: not available



500 600

Low -200 Spindle Speed (min⁻¹)

12000min⁻¹

238N•m(176ft•lbs)

Continuous rating

Spindle motor

HM400/50, HM500S/50

HM5100/HM6000S

HM630/HM800S HM800/HM1000S

HM1000/HM1250S

Spindle 0

10

5

0

12000min⁻¹ [30 / 25kW(40/34HP) MS]

-: not available

PALLET TABLE AND APC (AUTOMATIC PALLET CHANGER)

Table Indexing, Rotating Time and Accuracy


For the IT (Index Table) specification, the table index accuracy of 2.5 seconds is guaranteed by using the large-diameter curvic couplings.

For the BRT (Built-in Rotary Table) specification, that has a rotary encoder as standard equipment, the table index accuracy of 2.5 seconds is guaranteed.

Machine model	Type of table	Index and rotation time (per 90°)	
HM400/HM500S	BRT	0.5 sec	
nivi400/nivi5005	IT[Opt]	1.9 sec	
HM5100/HM6000S	BRT	0.5 sec	
HW5100/HW60005	IT[Opt]	1.7sec	
HM630/HM800S	BRT	0.6 sec	
	IT[Opt]	1.7 sec	
HM800	IT	4.5 sec	
HM1000S	IT	5.5 sec	
HM800/HM1000S	BRT[Opt] 1.2 sec		
HM1000/HM1250S	IT	5.0 sec	
	BRT[Opt]	1.8 sec	

IT: Index table BRT: Built-in-Rotary Table

Structure of BRT

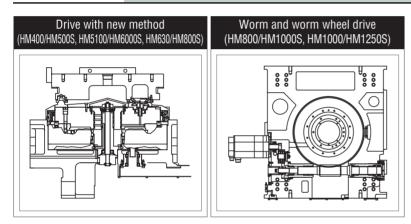

M400/HM500S, HM5100/HM6000S, and HM630/HM800S models incorporate a newly designed table with a highly rigid reduction gear in place of a conventional worm shaft and wheel. This gear has minimal backlash, holds up to impact, and performs table indexing accurately at higher speeds. HM800/HM1000S and HM1000/HM1250S models use


large-diameter bearings backing OKK's continuous improvements on rigidity.

Direct Turn APC (Automatic Pallet Changer)

The HM Series exploits the direct-turn APC unit consisting of only a pallet lift and turning mechanism. Fewer parts mean less downtime. HM1000 and HM1250S a table load of 5000kg (11000 lbs) is available as an option. All APC units have been built with expansion in mind whether it's a pallet pool or transfer system, flexibly supporting a variety of machining environments.

Machine model	Pallet changing time*1	Max. loadable weight on pallet kg (lb) ^{#2}	
HM400	9.5 sec	450 (992)	
HM500S	9.5 sec	450 (992)	
HM5100	10.5 sec	800 (1764)	
HM6000S	10.5 sec	700 (1543)	
HM630 15 sec		1300 (2600)	
HM800S 15 sec		1200 (2900)	
HM800 19 sec		2000 (4400)	
HM1000S 21 sec		2500 (5500)	
HM1000	IM1000 32 sec/43 sec[Opt] 3000 (6600)/5000 (11000)		
HM1250S	35 sec/43 sec[Opt]	3000 (6600)/5000 (11000) [Opt]	

*1: JIS regulation time *2: Uniformly distributed loading

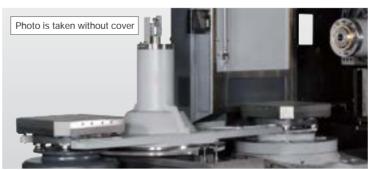


HM400 / HM500S




HM5100/HM6000S

High Precision Structure

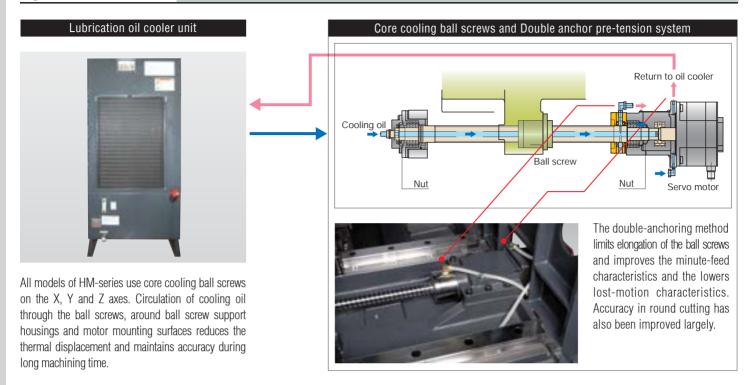


Double Anchored Core Cooling Ball Screw, and Linear Roller Guides

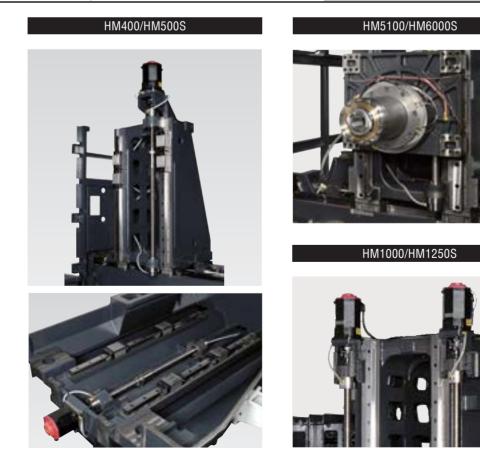



12

HM Series

Tool Magazine for BT40

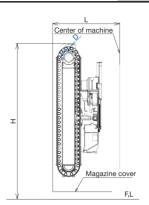

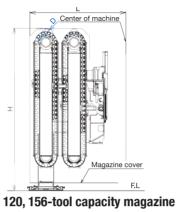

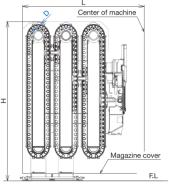

40, 60, 80-tool capacity magazine

178, 232-tool capacity magazine

Machine Model	HM400/40, HM500S/40			
Tool storage capacity ¹	L mm (in)	H mm (in)	D mm (in) ^{*2}	
40tools [Std]		2480 (97.64)		
60tools [Opt]	1315 (51.77)	3065 (120.67)		
80tools [Opt]		3915 (154.13)		
120tools [Opt]	1000 (70.00)	3150 (124.02)	ø160 (6.30)	
156tools [Opt]	1860 (73.23)	3875 (152.56)		
178tools [Opt]	0.405 (0.4.00)	3150 (124.02)		
232tools [Opt]	2405 (94.69)	3875 (152.56)		

*1: The number of tool storage capacity refers a total number including the tool installed in the spindle i.e. subtract one from the above for the actual number of storage capacity. *2: D shows the max. diameter of tool without tool in adjacent pot. It is ø82mm (3.23") when tool is in adjacent pot.



40-tool capacity [Std]



60-tooll x 2magazines=120-tool capacity [Opt]



80-tool x 3magazines=232-tool capacity [Opt]



Matrix magazine [Opt]


Restriction of tools

Machine model	Max. tool length	Max. diameter with tool in adjacent pot	Max. diameter without in adjacent pot	Max.weight of tool	Moment load
	mm (in)	mm (in)	mm (in)	kg (lb)	N·m (ft·lbs)
HM400/40, HM500S/40	400 (15.75) *1	ø82 (3.23) *1	ø160 (6.30) *1	12 (26.5) * ²	9.8 (7.2)
*** It's to delibe on deaths as shirtlers (D. S. etc. 1004)					


*1: It is loadable under the restriction. (Refer to P34)

*2: required slow ATC speed.

Tool Magazine for BT50

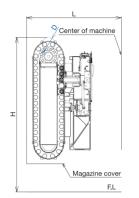

Center of machine Magazine cover F.L

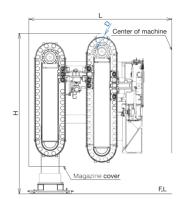

++++

40, 60-tool capacity magazine

80, 116-tool capacity magazine

120, 176-tool capacity magazine

	Machine Model	HM40	0/50, HM50)0S /50	HMS	5100/HM60	000S	HN	1630/HM80	00S	HM800/HM1000S		HM1000/HM1250S			
T	ool storage capacity ^{*1}	L mm(in)	H mm(in)	D mm(in) ^{*2}	L mm(in)	H mm(in)	D mm(in) ^{*2}	L mm(in)	H mm(in)	D mm(in) ^{*2}	L mm(in)	H mm(in)	D mm(in) ^{*2}	L mm(in)	H mm(in)	D mm(in) ^{*2}
4	0 tools [Std] ^{*1}	1715 (67 50)	2970 (116.93)		1990(78.35)	2915 (114.76)		0005 (70)	3170 (124.8)		0100 (05 0)	3375(132.9)		0000 (01 7)	3650 (143.7)	
e	io tools [Opt] ^{*3}	1715 (67.52)	4170 (164.17)		4115 (162.01)	2005 (79) 4370 (172.1)		2180 (85.8) 4335(17	4335(170.7)		2330 (91.7)	4610 (181.5)				
8	0 tools [Opt]	0E00 (00 C1)	3210 (126.38)	a2E0 (0.94)	0006/111.61)	3155 (124.21)	a200 (11 01)	2020 (111 1)	3410 (134.3)	a070 (10 60)	200E (117 0)	3615(142.3)	a070 (10 60)	2160 (124 4)	3890 (153.2)	a070 (10.62)
1	16 tools [Opt]	2530 (99.61)	4170 (164.17)	0200 (9.04)	.84) 2835(111.61)	4115 (162.01)	0000(11.01)	2820 (111.1)	4370 (172.1)	ø270 (10.63) 2	2990 (117.9)	4335(170.7)	10210 (10.03)	3160 (124.4)	4610 (181.5)	ø270 (10.63)
1	20 tools [Opt]	20000 (110 20)	3210 (126.38)		210/10/100	3155 (124.21)		2120 (122 0)	3410 (134.3)		2005 (100 7)	3615(142.3)		044E (10E C)	3890 (153.2)	
1	76 tools [Opt]	2850 (112.20)	4170 (164.17)		3150(124.02)	4115 (162.01)		3120 (122.8)	4370 (172.1)		3295 (129.7)	4335(170.7)		3445 (135.6)	4610 (181.5)	

*1: The number of tool storage capacity refers a total number including the tool installed in the spindle i.e. subtract one from the above for the actual number of storage capacity. (40, 60-tool magazine) *2: D shows the maximum diameter of tool when without tool in adjacent pot. It is ø115mm (4.53") when tool is in adjacent pot.

*3: Standard for HM5100/HM6000S.



60-tool capacity [Opt]



40-tool x 2 magazines=80-tool capacity [Opt]



60-tool x 4 magazines=236-tool capacity [Opt]



Matrix magazine [Opt]



Matrix magazine [Opt]

Restriction of tools

Machine model	Standard mm (in) Option mm (in) Standard mm (in) <th>Max. diameter with tool in adjacent pot^{~1}</th> <th>Max. diameter without in adjacent pots^{*1}</th> <th>Max. weight of tool</th> <th colspan="2">Moment load</th>		Max. diameter with tool in adjacent pot ^{~1}	Max. diameter without in adjacent pots ^{*1}	Max. weight of tool	Moment load	
			Standard mm (in)	mm (in)	kg (lb)	N·m (ft·lbs)	
HM400/50, HM500S/50			ø115 (4.53)	ø250 (9.84)	25 (55) *2	29.4 (21.7)	
HM5100/HM6000S			ø115 (4.53)	ø300 (11.81)	30 (66) * ²	29.4 (21.7)	
HM630/HM800S	500 (19.69)	600 (23.62)	62) ø115 (4.53) ø270 (10		25 (55) *3	29.4 (21.7)	
HM800/HM1000S	HM800/HM1000S 500 (19.69) 600 (23.62)		ø115 (4.53)	ø270 (10.63)	25 (55) *3	29.4 (21.7)	
HM1000/HM1250S 600 (23.62) —		ø115 (4.53)	ø270 (10.63)	25 (55)	29.4 (21.7)		
* The maximum work diamete	er is to be small	er when 600mm (23	62") tool length is u	sed (HM630/800S)		-: not available	

* The maximum work diameter is to be smaller when 600mm (23.62") tool length is used. (HM630/800S)

* When three or more multiple magazines, 600mm (23.62") length tools are usable in the first and second magazines.

In the 3rd or the following magazines, the maximum tool length shall be limited to 500mm (19.69"). *1: It is loadable under the restriction. (Refer to P34, P36, P38, P40, P42) *2: Required slow ATC speed.

*3: 30kg (66lbs) for the gear head spindle



HM Series

BT40

Use of the OKK's proven and original high-speed synchronous tool changer (OKK patented) provides the steady tool change and excellent durability. In order to realize the smooth tool change operation, the standard specification includes the variable ATC function and, when the ATC handles the tool such as the heavy tool and the large-diameter tool, the ATC turning speed slows down automatically if the slow turning is selected at the time of tool registration.

Max.time the farthest position to waiting position of magazing							
60-tool mag	gazine base	80-tool magazine bas					
60-tool	13 sec	80-tool	16.5 sec				
120-tool	26.7 sec	156-tool	31.3 sec				
178-tool	36.2 sec	232-tool	47.1 sec				

Tool change time (cut to cut)				
Machine model	Standard			
HM400/40, HM500S/40	3.3 sec			



HM400/HM500S

BT50

Max.time the farthest position to waiting position of magazine								
40-tool mag	gazine base	60-tool magazine base						
40-tool	40-tool 10.0 sec		13.5 sec					
80-tool	30.3 sec	116-tool	37.3 sec					
120-tool	33.2 sec	176-tool	40.2 sec					
160-tool	34.2 sec	236-tool	41.2 sec					

Tool c	hange time (cut to c	ut)		
Machine model	Standard	Gear-drive spindle		
HM400/50, HM500S/50	4.2 sec	_		
HM5100/HM6000S	3.6 sec	—		
HM630/HM800S	4.4 sec	5.0 sec		
HM800/HM1000S	5.8 sec	6.0 sec		
HM1000/HM1250S	6.2 sec	—		

-: not available



* 600mm (23.62") tool length specification is standard only for HM1000/HM1250S. The other models are option.

HM630/HM800S

15

POWERFUL FEEDING

HM Series



	Cutting data				
Machine model	HM800				
Tool	ø100mm (3.94") Face milling				
Material	FC300 (Cast iron)				
Spindle speed	800 min-1				
Feed rate	800mm/min (31.50 in/min)				
Depth of cut	3.0mm (0.12")				
Width of cut	90.0mm (3.54")				

++



Linear roller guide

The machines use an intense linear roller guide system that is simply built to last, through all high feed rates, rapid accelerations and performs superbly in high-load machining.

Ball screw with pre-lubricated seals

In order to reduce the environmental burdens, the grease lubrication method is used for lubricating the ball screws / feed guides.



Ball screw with pre-lubricated seals

Pallet positioning and clamping


Use of taper cones ensures high accuracy in repeated positioning of the pallets. Flatness of the pallet is secured accurately by means of the multi-clamp method. (HM400/HM500S use center clamp method.)



Multi-clamp method


Soft scale II m [Spindle thermal displacement compensation function]

Thermal displacement of the spindle can be a cause for fluctuating machining accuracy. The soft scale IIm reduces thermal displacement of the spindle and provides stable machining accuracy. The soft scale IIm constantly monitors a rotating status of the spindle and temperature of the spindle and the machine body in order to compensate automatically the thermal displacement according to changes in machine movement and based on the accumulated OKK's original data.

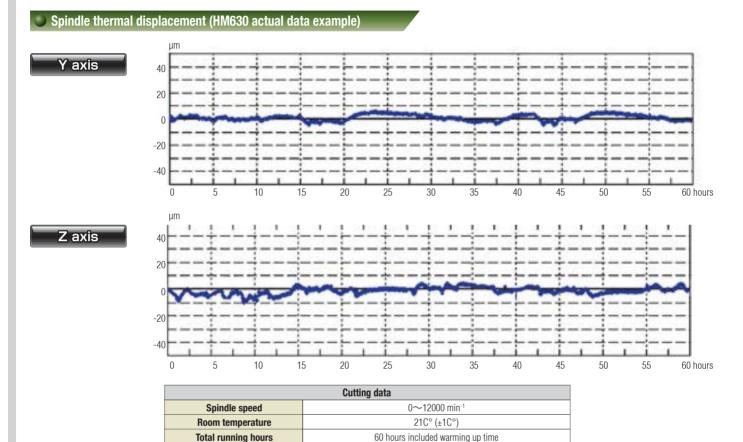

* Due consideration should be taken for the machine installation status, environmental temperature and operating condition. The data here may not be obtained due to these conditions.

Accuracy of roundness

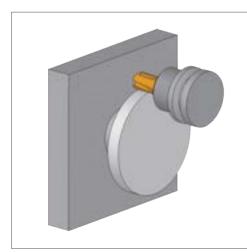

Roundness	Tolerance	Actual data example
HM400/HM500S	15 <i>µ</i> m(0.00059")	3.6µm(0.00014")
HM5100/HM6000S	15 <i>µ</i> m(0.00059")	3.8µm(0.00015")
HM630/HM800S	15µm(0.00059")	3.3µm(0.00013")
HM800/HM1000S	15µm(0.00059")	4.5µm(0.00018")
HM1000/HM1250S	15 <i>µ</i> m(0.00059")	5.0µm(0.00020")

+++1

Data condition						
Material	Alminum					
Cutting dia	250mm (9.85")					
Feed rate	F500mm/min (19.7in/min)					

Notes:


1. The data show example which obtained in short run. It may differ from data obtained in continuous run.

The data were obtained under OKK's test cutting conditions. The data may differ due to conditions of cutting tools, fixtures, cutting speed and room temperature.

The above accuracy are subject to machine installed according to OKK specifications and constant temperature environment. Accuracy are based on OKK inspection standard.

CUTTING CAPACITY

Cutting data

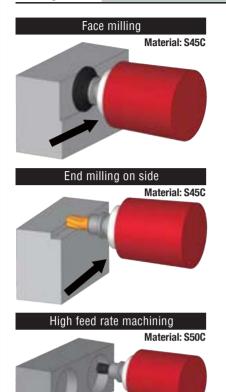

Face milling Material: S45C HM630/HM800S HM800/HM1000S ø125mm (4.9") x6 - tooth HM400/40, HM500S/40 HM5100/HM6000S HM1000/HM1250S ø100mm (4") x6 - tooth ø125mm (4.9") x6 - tooth ø125mm (4.9") x6 - tooth 300 min-1 Spindle speed 1000min-600min-1 300 min-1 80mm (3.15") 100 mm (3.94") **Cutting width** 100mm (3.94") 100 mm (3.94") **Cutting depth** 5mm (0.20") 5mm (0.20") 6 mm (0.24") 6 mm (0.24") Feed rate 800mm/min (31ipm) 1200mm/min (47ipm) 600 mm/min (23.6 in/min) 1000 mm/min (39.4 in/min) **Cutting amount** 320cm³/min (19.5in³/min) 600cm³/min (36.6 in³/min) 360 cm³/min (22 in³/min) 600 cm³/min (36.6 in³/min)


End milling on side Material: S45C

	HM400/40, HM500S/40 ø32mm (1.26") x6 - tooth	HM5100/HM6000S ø50mm (1.97") x6 - tooth	HM630/HM800S HM800/HM1000S ø50mm (1.97") x6-tooth Roughing end mill	
Spindle speed	speed 250 min ⁻¹ 16		160 min-1	160 min ⁻¹
Cutting width	32 mm (1.26") 20 mm (0.79")		25 mm (0.98")	15 mm (0.59")
Cutting depth	16 mm (0.63")	40 mm (1.57")	40 mm (1.57")	50 mm (1.97")
Feed rate	200 mm/min (7.87 in/min)	180 mm/min (7.09 in/min)	160 mm/min (6.3 in/min)	300 mm (11.8 in/min)
Cutting amount	Cutting amount 102 cm ³ /min (6.2 in ³ /min)		160 cm ³ /min (9.8 in ³ /min)	225 cm³/min (13.7 in³/min)

High feed rate machining Material: S50C

	HM630/HM800S, HM800/HM1000S ø50mm (1.97") High feed rate cutter
Spindle speed	1400 min ⁻¹
Cutting width	40 mm (1.57")
Cutting depth/round	0.5 mm (0.02")
Feed rate	7000 mm/min (276 in/min)

Sample work pieces

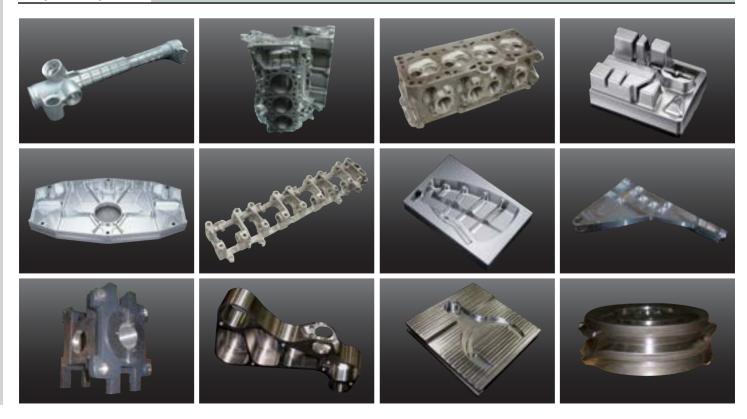

OPERATIONS

HM Series

Easy Operation

By the design of swivel operation panel and considerate splashguard of accessibility, the accessibility to spindle and pallet is significantly improved.





+++



HM400 / HM500S

HM5100 / HM6000S

HM800 / HM1000S

Easy loading and unloading

Front door of the APC opens wide so that the work loading/unloading and setup operations can be carried out easily.



Easy Tool Loading and Unloading in Tool Magazine

1 Magazine interruption function [Std]

During automatic operation, the tool loading and unloading operation in the tool magazine can be executed.

2 Operation panel [Opt]

Through a simple operation, a tool corresponding to a designated tool number is called up to the setup position inside the magazine.

S Foot-operated switch for removing a tool [Opt*]

The foot-operated switch eases removal of a tool from a magazine pot. *: Standard for Dual-contact holder



Operation Stand [Opt]



The operation stand is supplied optionally as needed. *: Standard for HM1000/HM1250S

Photo is an example of operation stand.

MAINTENANCE

HM Series

Maintenance

Daily maintenance equipment is easily performed at the back and one side of machine.



Daily maintenance equipment


Name of equipment

Air regulator

Air lubricator

Air dryer

Oil -in-air removing unit

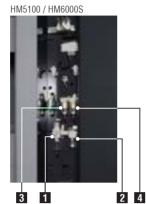



Name of equipment

Manual oil supply for magazine

Spindle oil-air unit

Hydraulic unit

Oil temperature control unit for Spindle and screws

+++

Automatic lubrication unit for magazine and ATC part [Opt]



Automatic grease lubrication unit for linear guides and ball screws [Opt]

Eco friendly

No.

1

2

3

4

ECO sleep function [Standard]

If the machine remains idle longer than the specified time period, the machine's present mode is switched to a power-saving mode to reduce wasteful consumption of power, air and so on. When the power-saving mode is active, the equipment such as servos and chip conveyors are turned off. It is cancelled automatically when the setup operation is completed i.e. when the doors are closed.

No.

5

6

7

8

Hydraulic free ATC unit *1

OKK has an added advantage of eco-friendly reliability with our use of a hydraulic free, mechanical cam driven ATC unit.

LED lamps

The machine incorporates LED lamps due to their low heat generation and power consumption savings. Furthermore, the LED lamps have a long life to save replacement money and maintenance.


Turning off lights inside the machine [Opt]

When the machine is not operated for a certain period of time, lights inside the machine are turned off automatically.

*1: Except for HM400/40, HM500S/40 and HM5100/HM6000S

Easy return of ATC and APC

Tools and pallets can be returned easily to origin position in accordance with monitor, even if stopped at half way of ATC and APC.

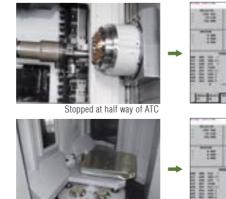

Stopped at the half way of APC



Guidance display for APC



LED lamp work light



ATC arm returned to origin position



Pallet returned to origin position



STANDARD AND OPTION LIST

HM Series

				Standard and optional Accessories			Standard 🗖	Optic	on 🗌	Not available
Itor	•				HM400/40	HM400/50	HM5100	HM630	HM800	HM1000
Iten	1			1	HM500S/40	HM500S/50	HM6000S	HM800S	HM1000S	HM1250S
Controller	FAN	ШС	FAi F31i							
oller			F31i-B5	Essential for the 5-axis simultaneous control					HM800 HM1000S H 	
Spindle taper and pull stud	Тар	per	BT40							
ndle		r	BT50 HSK-A63							
taper	Two faces HSK-/ contact holder		HSK-A100							
and	CONTRACT	noruci	BT type							
s lluq	Pull	stud	OKK90° MASI							
tud	1 un	Juu	MASII							
			10000min ⁻¹	37/26/22kW (50/35/30HP)						
Maximum spindle speed	BT40	MS	15000min ⁻¹ 20000min ⁻¹	37/26/18.5kW (50/35/25HP) 37/26/18.5kW (50/35/25HP)						
mum			200001111	22/18.5kW (30/25HP)						
ı spin		MS	8000min-1	30/25kW (40/34HP)						
Idle s	BT50	Gear		37/30kW (50/40HP)						
peed				22/18.5kW (30/25HP) 30/25kW (40/34HP)						
		MS	12000min ⁻¹	45/30/26kW (60/40/35HP)						
Та	Tab	ole	IT(Index Table)	Least Index 1°						
Table/Ax is			BRT(Built-in rotary table) nin (2953ipm)	Least Index 0.001°			X-axis•Z-axis only			Least Index 0.0001°
xis		f controlled			*1	*1	*1	*1	*1	*1
			40MG	40MG×1						
			60MG	60MG×1			*4			
	BT	40	80MG 120MG	80MG×1 62MG×2						
		-A63	156MG	80MG×2						
			178MG	62MG×3						
			232MG 200MG/300MG/400MG	80MG×3 Matrix magazine						
_	4 6 8 8 550 1 1 HSK-A100 1 1 2		40MG	40MGX1						
Magazine			60MG	60MGX1		*2	*2	*2	*2	*2
zine			80MG 116MG	44MG+40MG 60MG×2		*2	*2	*2	*0	*2
			120MG	44MG+40MG×2			~2	~2	<u>"</u> 2	~2
			160MG	44MG+40MG×3						
			176MG	60MG×3		*2	*2	*2		*2
			236MG 200MG/300MG/400MG	60MG×4 Matrix magazine		*2	*2	*2	*2	*2
			function	manx magazino						
-	lool holde	r remove by	2-pallet APC	Standard for BT50/HSK Dual-contact holder						
ha		0.0	Multiple APC	6-pallet APC						
For Automatic pallet hanger and Pallet	At	PC		8-pallet APC						
natic and F			Separate setup station for the multiple APC Note 1 Tapped type Pallet		25-M16 screw	25-M16 screw	24-M16 screw	24-M16 screw	24-M16 screw	24-M16 scrow(*3)
palle	Pa	llet	T-Slot type Pallet		20 10110 301000	20 10110 301000	24 10110 30100	24 10110 30100	24 10110 30100	24 10 30100 (3)
· #			Additional Pallet							
	Coola	nt tank	Standard Coolant tank Lift up chip conveyor	Hinged type/Scraper type/with Draum filter						
T			Coil conveyor	Bed left and right						
For Cool:	unip e	ejection	Chip flow coolant	Bed left and right						
olant			Spindrecoolant nozle							
ant and Ghip conveyor			Ceiling Shower Coolant shower gun							
Ghip			Air blow and oil mist							
conv	Col	llant	Coolant through spindle	2MPa (290psi)/7MPa (1015psi)						
eyor			Air through spindle Oil hole							
			Oil skimmer							
	Dubb		Mist collector							
Fora		chor pretens n oil cooler	sion ball screw unit	With core cooling ball screw						
For accuracy		le feed back		XY-axis or XYZ-axis						
acy	Coolant co									
	Signal tow			Tow lamp without buzzer						
	Working li Workpiece a		Touch sensor TO	LED light Manual measurement						
율	measuremer	nt	Touch sensor T1-A	Workpiece automatic measurement						
er ac		measurement	Touch sensor T1-B	Workpiece automatic measurement/ Tool length automatic measurement/ Tool break detection						
Other accessories	and break de Tool break d		Touch sensor T1-C Tool break detection in magazine*4	Tool length automatic measurement/Tool break detection Contact type or laser type						
ories	Automatic	grease lubr	ication unit	XYZ -axis/ball screw						
			on unit for MG and ATC part							
	Foundation Rotary win		nachine anchoring	Bond anchoring method at operation door						
	notary will	14011		αι οροιαίτοτι μουτ						


MG: Tool magazine unit

Note 1: The separate setup station for the multiple APC is regarded as the standard specification when the multiple pallet specification is selected. (Except for HM400/500S and HM5100/HM6000S) *1: The controller needs to be changed when the 5-axis simultaneous control is selected. *2: It is not available for the HSK-A100. *3: Twenty-four M20s are used for HM1250S. *4: It is available only for the FANUC controller.


OPTIONAL PERIPHERAL EQUIPMENT

HM Series

High pressure coolant through spindle [Opt]

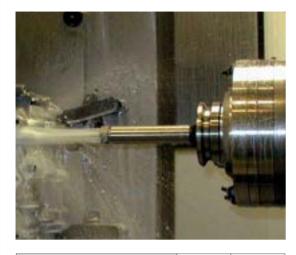

Discharge pressure I	2.0 (290)	7.0 (1,015)	
Discharge volume	50Hz	36 (9.5)	21 (5.5)
L/min (gpm)	60Hz	35 (9.2)	30 (7.9)

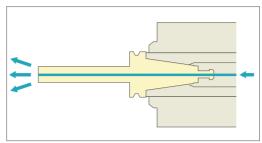

High pressure coolant is supplied to the tip of a cutting tool through the center hole of spindle and the cutting tool. It is very efficient for chip removal, cooling the cutting point and extending the life of cutting tools. Air supply through the spindle is also available by switching a valve. [Another Opt]

*Actual discharge volumes from the tool are different due to the hole-diameter

*Discharge values indicated are at the outlet of pump.



High pressure coolant unit



Thickener bag filter

Coolant shower gun [Opt]



Automatic lubrication unit for magazine and ATC part [Opt]*2



Air blow nozzle [Opt]

Notes

of cutter tools.



Mist collector [Opt]*3



Mist collector suctions mist from the splash guards and is recommended when high-pressure coolant is used.

Automatic grease lubrication unit for linear guides and ball screws [Opt] *1



Oil mist & Air blow [Opt]



*1: Only for HM630/HM800S, it is regarded as the optional specification. *2: Standard for HM5100/HM6000S, HM1000/HM1250S.


^{*3:} We can provide the mounting holes in the splash guard and a terminal block for wiring in the control panel for the customer to install the equipment that the customer prepares for themselves.

HM Series

For more stable machining accuracy


Coolant cooler [Opt]


Oil temperature has a major factor in thermal displacement of machine. Coolant cooler suppresses rise of temperature generated during machining and achieves a stable machining accuracy. This option is recommendable for accurate machining. This option is also strongly recommended, when the oil-based coolant is used.

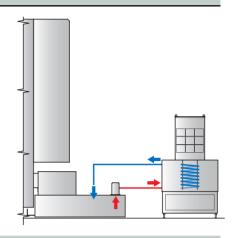

Spindle

Dual-contact [Opt]

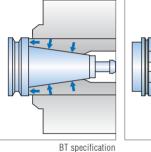

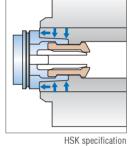



on Spindle for Dual-contact holder of BT50



Dual-contact holder is loaded, no space

between holder and spindle nose.



HSK-A63

Improvements in rigidity of tools have been achieved by contact faces of spindle-nose and tool holders flange. This has a great effect not only for heavy load machining but also high speed machining.

(The performance is different due to the cutting tools and cutting conditions.)

Stopper block [Opt]

1) For high speed spindle holder


2) For high speed spindle holder with coolant jacket


3) For angle head


Notes: Please inform OKK the brand name and model when you order this stopper block.

Type of pull stud


	7/24 taper No.40	7/24 taper No.50
OKK90°	Option	Standard
MASI	Standard	Option
MASII	Option	Option

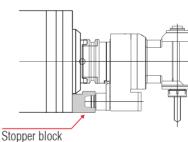

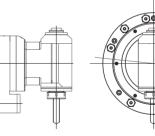

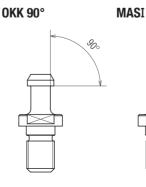

MASI



Lift up chip conveyor [Opt]

Sui	Suitable lift up chip conveyor according to type of chips						$\bigcirc{\sf Mostsuitable}\bigcirc{\sf Usable}\bigtriangleup{\sf Usableundercondition}\times{\sf Notusable}$ - Not applicable							
			Type of chip conveyor		Hing	e type	Scraper type Magnet Scraper type		Scraper type with drum filter		Magnet scraper type with drum filter			
			Use or not use coolant oil		Use	Not use	Use	Not use	Use	Not use	Use	Not use	Use	Not use
			Short curl	\bigcup	\odot	0	0	0	O	0	0	-	O	-
	S		Spiral	00005	O	O	∆*2	∆*2	∆*2	∆*2	×	-	×	-
	e chip	Steel	Long	sv2	O	O	×	×	×	×	×	-	×	-
	Magnetizable chips		Needle shape	11	×	∆*1	×	0	⊜*3	0	\bigcirc	-	O	-
s	agnei		Powder and small lump		×	∆*1	×	0	⊜*3	0	\bigcirc	-	O	-
of chips	×	iron	Needle shape	11	×	∆*1	×	0	⊜*3	0	\bigcirc	-	O	-
Type of		Cast	Powder and small lump		×	∆*1	×	0	⊜*3	0	∆*3	-	0	-
E.	bs		Short curl	\bigcup	×	0	∆*4	0	-	-	\bigcirc	-	0	-
	ble chi	E	Spiral	00005	0	0	0	0	-	-	∆*5	-	∆*5	-
	netiza	Alminum	Long	Svo	0	0	0	0	-	-	∆*5	-	∆*5	-
	Non-magnetizable chips	A	Needle shape	11	×	∆*1	×	0	-	-	\bigcirc	-	0	-
	Noi		Powder and small lump		×	∆*1	×	0	-	-	\bigcirc	-	O	-

*1 Minute chips can enter the conveyor through a gap on the hinged plate. So, inside of the conveyor needs frequent cleaning.


*2 Scraper can easily catch long chips. So, shortening the chips (for example by using the step feed) or removing such chips is required.

*3 When flow rate of the coolant is large, filters can be clogged with chips flowed out of the conveyor case. Therefore, combined use with a magnet plate is recommendable.

*4 When flow rate of the coolant is large, filters can be clogged with chips flowed out of the conveyor case. Therefore, filters require frequent cleaning.

*5 Scraper can easily catch long chips. Therefore, periodical removal of chips is needed. If they remain, a drum filter may be damaged.

Height of chip drop							
Type of chip conveyor	Hinged type, Scraper type and Magnet scraper type	Scraper type with drum filter	Magnet craper type with drum filter				
HM400/HM500S	1020 mm (40.16")	1100 mm (43.31")	1100 mm (43.31")				
HM5100/HM6000S	1020 mm (40.16")	1220 mm (48.03")	1220 mm (48.03")				
HM630/HM800S	1020 mm (40.16")	1220 mm (48.03")	1220 mm (48.03")				
HM800/HM1000S	1070mm (4213")	1200mm (4724")	1200mm (4724")				
HM1000/HM1250S	1070mm (4213")	1200mm (4724")	1200mm (4724")				

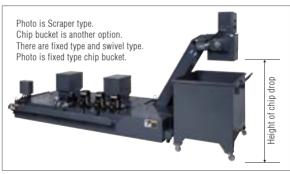

++++

Magnet separator [Opt]



As an option for the lift-up chip conveyor, adding a magnet separator is possible for collecting powder and particle casting chips and preventing accumulation of chips inside tanks and clogging of devices such as pumps and filters.

Oil skimmer [Opt]



Oil skimmer collects contaminated oil from a coolant tank.

Rotary wiper [Opt]



Install on operators window

HM Series

Automatic measurement and Tool breakage detection with OKK Touch sensor system [Opt]

Model of touch sensor system

Function	Description	Systen	n name
Workpiece measurement and compensation	 Load the touch sensor into the spindle.Automatic operations will bring the sensor or into contact with the workpiece. The workpiece coordinate system will be measured and the necessary compensation amount will be updated. Program instructions are issued according to the specified format. 	T1-A	
Tool length measurement	 When a tool is commanded for tool leugth check, automatic operations will bring the tool in contact with the table mounted touch sensor. This operation will update the tool leugth offset for that tool. Measurement and compensation programs in accordance with the specified format are produced and executeed. Applicable tools: Drills and taps 	T1-C	T1-B
Tool break detection	 When a tool is commanded for broken tool check, automatic operations will bring the tool in contact with the table mounted touch sensor. If the tool tip does not make contact with the sensor at the designated offset length the tool is determined to be broken. This checking command can be put into the machining program at any point. Applicable tools: Drills and taps Details of the movement when tool break is detected depend on the specifications of the machine main unit. 		

*Adding the T0 software enables also the manual measurement. Please refer to "T0 software [Opt]" on the page 29.

Tool length measurement and Tool breakage detection

A tool in the tool magazine is called up to the spindle, and length of the tool is measured automatically and registered automatically as data of the tool length in respective offset number. After the tool is used in machining, the tool can be checked for breakage automatically. If the tool is detected as damaged, the machine issues an alarm and stops operating.



Tool breakage detection in tool magazine [Another Opt]

This function enables detecting tool breakage in the tool magazine while the machine is in the automatic operation.

* Non contact type sensor of laser system is also available.



— Type of sensor



[OMP60] Renishaw

Use the optical signal transfer method. The signal receiver block is not needed since signals are sent and received by using infrared rays. The signal receiver module can be fitted on inside wall of splash guard.



[**RMP60**] **Renishaw** Use the radio signal transfer method. It is suitable for the machines having long distance for signal transfer from the sensor to the receiver such as the large models and 5-axis machining centers.



With a low and consistent trigger force in all sensing directions, the MP700 is ideal for complex and contoured part inspection.




[TC50] Blum


The multidirectional touch probe TC50 allows fast, precise and automatic determination of workpiece position and workpiece dimensions in machining centers.

Manual measurement with software of touch sensor system TO

A sensor is moved to the desired measuring position by operating a manual handle. The machine starts measuring automatically when the sensor comes into contact with a workpiece, and results of the measurement are reflected in the settings of desired work coordinate system and tool offset number through a simple operation.




- The following centering and measuring are available.









Hydraulic and compressed air supply ports for fixture [Opt]

Rotary joint on pallet system (Example 1)



Example of the use of 6-port rotary joint (HM400/500S, HM5100/HM6000S)

Supply from above the fixture: Hydraulic or air pressure can be applied to the clamping device constantly so that the workpiece clamping device is prevented from getting loose during machining. However, height of the fixture is limited due to a rotary joint and its piping installed above the fixture.

++++

The pallet-through method is simple and does not require a rotary joint and its piping above the fixture. However, the clamp/unclamp function is available only in the setup station.

(Hydraulic pressure and air pressure are not supplied after moving to the machining position.)


		OAvaiable ×Not avaiable
	Rotary joint on pallet system	pallet through
HM400/HM500S	0	0
HM5100/HM6000S	0	0
HM630/HM800S	0	×
HM800/HM1000S	0	0
HM1000/HM1250S	0	0

Note1: The pallet-through system allows the clamping operations of the fixtures only in the work setup station. Note2: Availability is depends on the supply source (hydraulic or air), pressure, number of ports and other specification.

Rotary joint on pallet system (Example 2)



Example of the use of 3-port rotary joint (HM630/HM800S, HM800/HM1000S, HM1000/HM1250S)







Pallet through system (Use auto-coupler)




Pallet through system (Use auto-coupler)

Fixture example

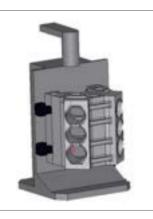

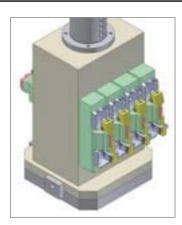



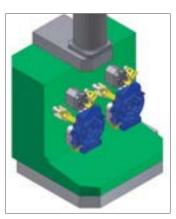

HM Series


Multiple-pallet APC [Opt]




HM5100/HM6000S


[6-pallet with set-up station (pattern 1)]

[6-pallet with set-up station (pattern 2)]

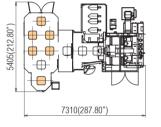


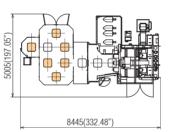

[8-pallet with set-up station (pattern 1)]

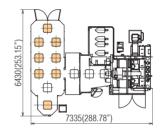

[8-pallet with set-up station (pattern 2)]

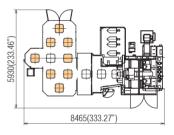

HM630/HM800S




HM630 6-pallet APC (Horizontal type) Photo is taken without safety cover.




HM1000 6-pallet APC (Horizontal type) Photo is taken without safety cover.


[6-pallet vertical type with set-up station]

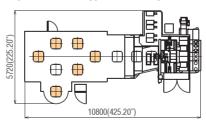


[8-pallet vertical type with set-up station]

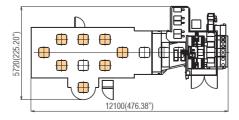


[6-pallet horizontal type with set-up station]

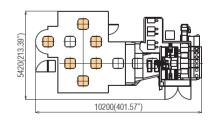

[8-pallet horizontal type with set-up station]

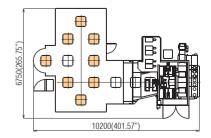


HM800/HM1000S

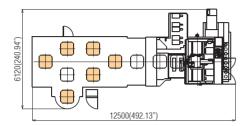


[6-pallet vertical type with set-up station]



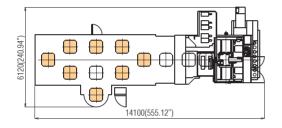


HM1000/HM1250S

[6-pallet horizontal type with set-up station]

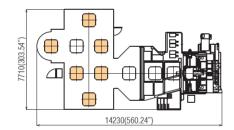


[6-pallet horizontal type with set-up station]


++++

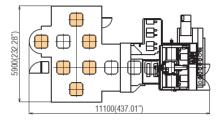


[8-pallet horizontal type with set-up station]

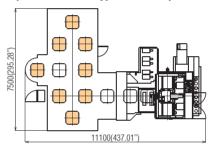

[6-pallet vertical type with set-up station]

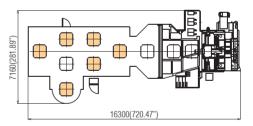

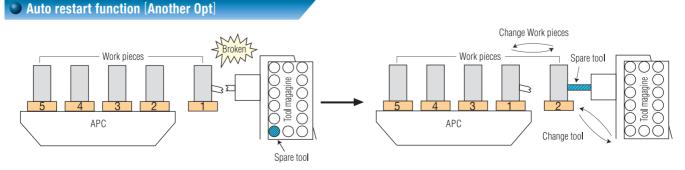

When a tool failure detected by a tool breakage detection system such as soft CCM, touch sensor system T1-C or others, automatic restart stops the machine and interrupts processing. The system will exchange the broken tool with an available spare tool then will either execute an APC or program end command.

OKK's exclusive control functions

Programming support functions

Program Editor [F31i-B]

Program editor allows you to edit programs stored in NC memory, from a data server (or hard disc) or memory card.



- Two programs can be displayed side by side.
 Characters in the program can be converted all at once. (Example: Changes F1000 to F1200.)
- Multiple-line data can be copied from other programs with ease.



By switching the right-side screen for reference use, a list of M signals/G codes and information on tools in the magazine can be displayed.



- Programs can be copied or deleted and program names can be changed easily with the Program Editor.
- The Program Editor's multiple-file batch copy function enables to make a backup of the programs in the NC memory or hard disc easily with a memory card.

Setup support functions

Tool Support [F31i-B]

Now through a single set-up screen the tools number, description, schematic, and geometry are displayed. You can also perform the tool change commands and measurement cycle at the same set-up screen.

Tool setup screen




Tool length compensation amount measurement screen



T0 software [Opt]

This screen enables the simple manual measurement using the touch sensor (option: T1-A or T1-B). You can move the sensor to the desired measuring point by handle mode then the machine starts the automatic measurement after the sensor contacts the workpiece. You can set the results of the measurement as the data for the desired workpiece coordinate system and tool offset number through the single key operation.

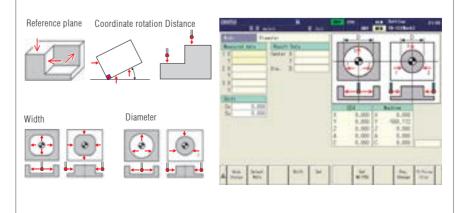

Maintenance functions

Help Guidance [F31i-B]

The screen will display detailed information regarding the machine alarm and will explain how to recover the machine from the problem. This screen will also display a list of G-codes and a description of M signals.

Display of details of alarms



Description of M signals

· .	-	٠.			-	
.	يهما ليسود					
Farmer						
11111	into controls 5 and Theorem a	And the second s	Balt to offer the tagestic Coloriantic of the CHO	A ART Has being all and a a stored a	shari 1.000 a.	
-	1	1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1		to the state	P 27	
A						
1	-		11			100

High-efficiency Control Technologies

Hyper HQ Control [Opt]

High-speed processing is enabled by improved capability of processing fine line segment toolpaths.

+++

F31i-B/FAi capability of processing fine line segments

Туре		ita processing speed min)	Instruction method
	F31i-B	FAi	
Without Hyper HQ control	15 (591 ipm)		
Hyper HQ control mode A	30 (1181 ipm)		ON: G05.1Q1; OFF: G05.1Q0
Hyper HQ control mode B	150 (5906 ipm)	—	ON: G05.1Q1; OFF: G05.1Q0

The above values show (theoretical) maximum speeds for processing 1-mm-segment blocks constructing a straight line. Actual processing speeds depend on the type of the machine and NC data.

HQ Tuner [Opt]

The HQ tuner provides the programmer a 10-step adjustment of parameters for hyper HQ control in accordance with processing conditions.

It adjusts the hyper HQ control in accordance with the current process.

For example, during roughing routines the programmer can place a higher priority on speed and in finishing routines a higher priority on dimensional accuracy at corners and circular arcs.



Technologies for Reduced Setup and Unmanned Operation

Soft AC [Opt]

The soft AC function applies the feed rate override control automatically so that the value of the spindle load meter does not change significantly. This helps to prevent damages of tools caused by overload and improve cutting efficiency.

Adaptive control function

- Feed override control range: 10 to 200% (Changeable with parameters)
- Alarms are output at the lower limit override value.
- Air-cut reduction function
 Feed rates during non-cutting operation can be increased up to 200%.
 (Changeable with parameters)
- Tool failure monitoring function Specifications similar to the soft CCM.
- Continuous unmanned machining at the time of tool failure (option) Combined operation with the automatic restart function is possible.

Soft CCM [Opt]

The Soft CCM monitors the spindle load meter, and stops operation when the meter value exceeds the preset value (set by M signal or set for each of the T numbers through setting screen) and generation of abnormal tool load is determined which is convenient for unmanned operation at night.

High-efficiency Control Technologies

Data Server [Opt]

A large amount of machining programs can be transferred to the data server through the network connected to the host computer at high speed. The transferred machining programs are executed as the main programs or sub-programs (called up by using the M198 signal.)



CONTROLLER

HM Series

FANUC Controller F31i-B

(Windows CE-installed Open CNC)

Standard Specification

No. of controlled axes: 4 axes (X, Y, Z, B) No. of simultaneously controlled axes: 3 axes (4 axes for BRT specification) Least input increment: 0.001mm / 0.0001" Max.programmable dimension: ±999999.999mm / ±39370.0787" Absolute / Incremental command: G90 / G91 Decimal point input / Pocket calculator type decimal point input Inch / Metric conversion: G20 / G21 Program code: ISO / EIA automatic discriminaton Program format: FANUC standard format Nano interpolation (internal) Positioning: G00 Linear interpolation: G01 Circular interpolation: G02 / G03 (CW / CCW), including radius designation Cutting feed rate: 6.3-digit F-code, direct command Dwell: G04 Manual handle feed: manual pulse generator 1 set(0.001, 0.01, 0.1mm) Rapid traverse override: 0 / 1 / 10 / 25 / 50 / 100% Cutting feed rate override: 0 to 200% (every 10%) Feed rate override cancel: M49 / M48 Rigid tapping: G84, G74 (Mode designation: M29) Part program storage capacity: 160m [64KB] No. of registered programs: 120 Part program editing Background editing Extended part program editing 10.4" color LCD **Clock function** MDI (Manual Data Input) operation Memory card interface Spindle function: 5-digit S-code direct command Spindle speed override: 50 to 150% (every 5%) Tool function: 4-digit T-code direct command ATC tool registration Auxiliary function: 3-digit M-code programming Multiple M-codes in 1 block: 3 codes (Max. 20 settings) Tool length offset: G43, G44/G49 Tool diameter and cutting edge R compensation: G41, G42/G40 Tool offset sets: 99 sets in total Tool offset memory C Manual reference position return Automatic reference position return: G28/G29 2nd reference position return: G30 Reference position return check: G27 Automatic coordinate system setting Coordinate system setting: G92 Machine coordinate system: G53 Workpiece coordinate system: G54 to G59 Local coordinate system: G52 Program stop: M00 Optional stop: M01 Optional block skip: / Drv run Machine lock Z-axis feed cancel Auxiliary function lock Graphic display Program number search

Sequence number search

Standard Specification
Program restart
Cycle start
Auto restart
Single block
Feed hold
Manual absolute on/off: parameter
Sub program control
Canned cycle: G73, G74, G76, G80 to G89
Mirror image function: parameter
Automatic corner override
Exact stop check/mode
Programmable data input: G10
Backlash compensation for each rapid traverse and cutting feed
Smooth backlash compensation
Memory pitch error compensation (interpolation type)
Skip function
Tool length manual measurement
Emergency stop
Data protection key
NC alarm display / alarm history display
Machine alarm display
Stored stroke limit 1
Stored stroke limit 2, 3
Load monitor
Self-diagnosis
Absolute position detection
Manual guide i (Basic)

Optional Specification

15" color LCD	
Additional one axis control: name of axis(A, B, C, U, V, W)	*
Additional two axes control: name of axis(A, B, C, U, V, W)	*
No. of simultaneously controlled axes: 5 axes	*
Least input increment: 0.0001mm / 0.00001"	
FS15 tape format	
Unidirectional positioning: G60	
Helical interpolation	PK1
Cylindrical interpolation	
Hypothetical axis interpolation	
Spiral/Conical interpolation	
Smooth interpolation (Hyper HQ control B mode is required)	
NURBS interpolation (Hyper HQ control B mode is required)	
Involute interpolation	
One-digit F code feed	
Handle feed 3 axes(Standard pulse handle is removed)	
Part program storage capacity: 320m [128KB] (250 in total)	
Part program storage capacity: 640m [256KB] (500 in total)	
Part program storage capacity: 1280m[512KB] (1000 in total)	PK1
Part program storage capacity: 2560m [1MB] (1000 in total)	
Part program storage capacity: 5120m[2MB] (1000 in total)	
Part program storage capacity: 10240m [4MB] (1000 in total)	
Part program storage capacity: 20480m[8MB] (1000 in total)	
RS232C interface: RS232C-1CH	
Data server: ATA card (1GB)	PK2
Data server: ATA card (4GB)	
Spindle contour control (Cs contour control)	
Tool position offset	
3-dimensional cutter compensation	

Optional Specification	
Tool offset sets: 200 sets in total	PK1
Tool offset sets: 400 sets in total	
Tool offset sets: 499 sets in total	
Tool offset sets: 999 sets in total	
Addition of workpiece coordinate system (48 sets in total): G54.1 P1 to P48	PK1
Addition of workpiece coordinate system (300 sets in total): G54.1 P1 to P300	
Machining time stamp	
Addition of optional block skip: 9 in total	
Tool retract and return	
Sequence number comparison and stop	
Manual handle interruption	
Programmable mirror image	PK1
Optional chamfering / corner R	
Custom macro	PK1
Interruption type custom macro	
Addition of custom macro common variables: 600	
Figure copy	
Coordinate system rotation: G68, G69	
Scaling: G50, G51	
Chopping (Axis control by PMC)	
Playback	
Tool life management: 256 sets in total	PK1
Addition of tool life management sets: 1024 sets in total	
High-speed skip	
Run hour and parts count display	PK1
Manual guide i (Milling cycle)	

Original OKK Software

Machining support integrated software (including Help guidance	, etc.) STD
Tool support	STD
Program editor	STD
EasyPRO	STD
Work manager	OP
HQ control	STD
Hyper HQ control mode A	OP
Hyper HQ control mode B	PK2 OP
Hyper HQ value kit (including the items with "PK2")	OP
NC option package (including the items with "PK1")	OP
Special canned cycle (including circular cutting)	OP
Cycle mate F	OP
Soft scale IIm	STD
Touch sensor T0 software	OP
Tool failure detection system (Soft CCM)	OP
Adaptive control (Soft AC)	OP
Automatic restart at tool damage	OP

*F31i-B5 (Windows CE-installed Open CNC) controller is required STD: Standard OP: Option

FANUC Controller FAi

No. of controlled axes: 4 axes (X, Y, Z, B) No. of simultaneously controlled axes: 3 axes (4 axes for BRT specification Least input increment: 0.001mm / 0.0001"
No. of simultaneously controlled axes: 3 axes (4 axes for BRT specification
Least input increment: 0.001mm / 0.0001"
Louot inpar moromone. 0.00 mmm / 0.000 m
Max.programmable dimension: ±999999.999mm / ±39370.0787"
Absolute / Incremental command: G90 / G91
Decimal point input / Pocket calculator type decimal point input
Inch / Metric conversion: G20 / G21
Program code: ISO / EIA automatic discriminaton
Program format: FANUC standard format
Nano interpolation(internal)
Positioning: G00
Linear interpolation: G01
Circular interpolation: G02 / G03 (CW / CCW), including radius designation
Unidirectional positioning: G60
Helical interpolation
Cylindrical interpolation
Cutting feed rate: 6.3-digit F-code, direct command
Dwell: G04 Manual bandle feed: manual pulse generator 1 set (0.001, 0.01, 0.1mm)
Manual handle feed: manual pulse generator 1 set (0.001, 0.01, 0.1mm) Rapid traverse override: 0 / 1 / 10 / 25 / 50 / 100%
Cutting feed rate override: 0 to 200% (every 10%)
Feed rate override cancel: M49 / M48
Rigid tapping: G84, G74 (Mode designation: M29)
One-digit F code feed
Inverse time feed
Part program storage capacity: 1280m [512KB]
No. of registered programs: 400
Part program editing
Background editing
Extended part program editing
10.4" color LCD
Clock function
MDI(Manual Data Input) operation
Run hour and parts count display
Memory card interface
Spindle function: 5-digit S-code direct command
Spindle speed override: 50 to 150% (every 5%)
Tool function: 4-digit T-code direct command
ATC tool registration
Auxiliary function: 3-digit M-code programming
Multiple M-codes in 1 block: 3 codes (Max. 20 settings)
Tool length offset: G43, G44/G49
Tool diameter and cutting edge R compensation: G41, G42/G40
Tool offset sets: 400 sets in total
Tool offset memory C
Tool position offset
Manual reference position return
Automatic reference position return: G28/G29
2nd reference position return: G30
Reference position return check: G27 Automatic coordinate system setting
Coordinate system setting: G92
Machine coordinate system: G53
Workpiece coordinate system: G54 to G59
Local coordinate system: G52
Addition of workniece coordinate system (48 sets in total)- GSA 1 P1 to DA9
Addition of workpiece coordinate system (48 sets in total): G54.1 P1 to P48 Program stop: M00

Standard Specification
Optional block skip: /
Addition of optional block skip: 9 in total
Dry run
Machine lock
Z-axis feed cancel
Auxiliary function lock
Graphic display
Program number search
Sequence number search
Program restart
Cycle start
Auto restart
Single block
Feed hold
Manual absolute on/off: parameter
Sequence number comparison and stop
Manual handle interruption
Sub program control
Canned cycle: G73, G74, G76, G80 to G89
Mirror image function: parameter
Automatic corner override
Exact stop check/mode
Programmable data input: G10
Scaling: G50, G51
Custom macro
Interruption type custom macro
Addition of custom macro common variables: 600
Programmable mirror image
Coordinate system rotation: G68, G69
Optional chamfering / corner R
Manual guide i (Basic)
Backlash compensation for each rapid traverse and cutting feed
Memory pitch error compensation
Skip function
Tool length manual measurement
Tool life management: 128 sets in total
Emergency stop
Data protection key
NC alarm display / alarm history display
Machine alarm display
Stored stroke limit 1
Stored stroke limit 2, 3
Load monitor
Self-diagnosis
Absolute position detection
Optional Specification
Additional one axis control: name of axis (A, C, U, V, W) (No. of simultaneously controlled axes: 4 axes)

Original OKK Software	
HQ control	STD
Hyper HQ control mode A	OP
Soft scale IIm	STD
Special canned cycle (including circular cutting)	OP
Touch sensor T0 software	OP
Tool failure detection system (Soft CCM)	OP
Adaptive control (Soft AC)	OP
Automatic restart at tool damage	0P

++++

Additional two axes control: name of axis (A, C, U, V, W) (No. of simultaneously controlled axes: 4 axes) FS11 tape format

Part program storage capacity: 5120m [2MB] (400 in total) Data server: ATA card (1GB) Spindle contour control (Cs contour control) Manual guide i (Milling cycle)

High-speed skip

RS232C interface: RS232C-1CH

HM Series HM400/HM500S


Standard Specifications

Item		HM400/40	HM500S/40	HM400/50	HM500S/50	
Travel on X axis (Column: right/left)	mm			24.80")		
Travel on Y axis (Spindle head: up/down)	mm	620 (24.41")				
Travel on Z axis (Table: back/forth)	mm	710 (27.95")				
Distance from table top surface to spindle center	mm	80~700 (3.15"~27.55")	50~670 (1.97"~26.38")	80~700 (3.15"~27.55")	50~670 (1.97"~26.38")	
Distance from table center to spindle nose	mm		1	91"~33.86")		
Pallet work surface area	mm	400 (15.75")	500 (19.69")	400 (15.75")	□500 (19.69")	
Max. weight loadable on pallet	kg		(Uniform load) 450 (992lbs)		
Pallet top surface configuration			25×N	116tap		
Minimum indexable angle of table	deg		BRT 0.001 ,	/ IT[Opt] 1*1		
Table index time (for indexing 90 degrees)	sec		BRT 0.5 /	IT[Opt] 1.9		
Spindle speed	min-1	35~1	0,000	35~1	2,000	
Number of spindle speed change steps			Electric 2-step sp	beed change (MS)		
Spindle inner taper		7/24 tap	er, No.40	7/24 tap	er, No.50	
Spindle bearing inner diameter	mm	ø80 (3.15")	ø100	(3.94")	
Rapid traverse rate	m/min		54 (2,1	26 ipm)	× ,	
Cutting feed rate	mm/min		1~40,000 (0.0	4~1574 ipm)*2		
Type of tool shank		JIS B 63	339 BT40	JIS B 63	39 BT50	
Type of pull stud		MAS403 P4	IOT-1 (MASI)	ОКК о	nly 90°	
Tool storage capacity	tool		40)* ³	•	
Maximum tool diameter	mm	ø82 (3.23") / ø160 (6.30")	without tool in adjacent pot	ø115 (4.53") / ø250 (9.84")	without tool in adjacent po	
Maximum tool length (from the gauge line)	mm			15.75")		
Maximum tool weight	kg	12 (26 lbs) with	n slow ATC cycle	25 (55 lbs) with	slow ATC cycle	
Maximum tool moment	N·m	9.8 (7.2	2 ft · lbs)	29.4 (21	29.4 (21.7 ft · lbs)	
Tool selection method			Address fixed	random system		
Tool change time (cut-to-cut)	Sec	3	.3	4	.2	
Pallet change method			Direc	t turn		
Pallet change time (JIS evaluation time)	Sec		9	.5		
Spindle motor	AC, kW	FANUC 37 (50F 22 (30HP) (25%ED	HP)/26 (35HP) / /30min/cont. rating)	FANUC 30 25 (34HP) (30r) (40HP) / nin/cont. rating)	
Feed motor (X,Y,Z,B)	kW	FANUC 5.5 (7.4	4HP) / 5.5 (7.4HP) / 4.5 (6.0	HP) /BRT: 4.5 (6.0HP) (IT[0p	ot]: 4.5 (6.0HP))	
Hydraulic pump motor	kW		1.5 (2	2.0HP)		
Motor of oil cooler for spindle and feed system(compression/discharge)	kW		1.1 (1.5HP)	/ 0.4 (0.5HP)		
Coolant pump motor	kW		50Hz: 0.7 (0.9HP)	60Hz: 1.2 (1.6HP)		
Power supply AC200V±10% 50/60±1Hz AC220V±10% 60±1Hz*4	kVA	FANI	JC 56	FANI	JC 62	
Compressed air supply	MPa, ℓ/min [ANR]		0.4~0.6*5, 500*6(58/	~87 psi, 132 gal/min)		
Hydraulic unit tank capacity	l		20 (5	.3 gal)		
Spindle and feed system cooling oil tank capacity	l	20 (5.3gal)				
Coolant tank capacity	l	480 (127 gal)				
Machine height	mm	2844 (111.97") 2970 (116.93")				
Required floor space	mm		Refer to the floor	r space drawing.		
Machine weight	kg	12,000 (26,455 lbs)	12,200 (26,896 lbs)	12,500 (27,557 lbs)	12,700 (27,998 lbs)	
Operating environment temperature	°C	. ,		-40		


*1 BRT: Built-in rotary table minimum indexing 0.001° IT: Index table minimum indexing 1°
*2 Available under the HQ or hyper HQ control.
*3 The number of stored tools refers a total number of tools including the one installed on the spindle i.e. subtract one from the above for actual number of tools stored in the tool magazine.
*4 When the supply voltage is 220VAC, the supply frequency of 60Hz only is applicable.
*5 Purity of compressed air should be class 3.5.4 or higher class of ISO 8573-1/JIS B8392-1 standard.
*6 Specified is the compressed air supply flow rate for standard specification machines. When optional specifications such as an air blow nozzle are added, add the corresponding air supplyrequirement.

Machine Dimensions

Floor Space

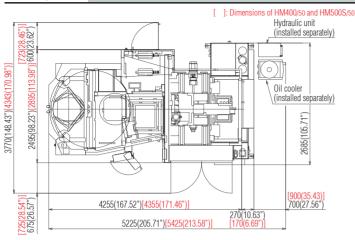

Pallet Dimensions

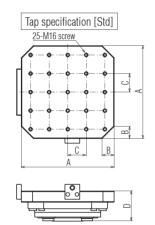


a*edgelocater[Opt]


Pallet dimensions

		А	В	С	D
HM400		400(15.8")	50(1.97")	80(3.15")	130(5.12")
HM500S		500(19.7")	65(2.56")	100(3.94")	160(6.30")
HM400(T-slo	t)	400(15.8")	50(1.97")	80(3.15")	160(6.30")
HM500S(T-sl	ot)	500(19.7")	65(2.56")	100(3.94")	190(7.48")

mm(in)

Restriction on Tool






XYZ axis travel diagrams

XYZ axis tr	XYZ axis travel diagrams mm(in)											
	А	В	С	D	E	F	G	Н				
HM400	400(15.75")	900(35.43")	700(27.56")	80(3.15")	160(6.30")	200(7.87")	50(1.97")	110(4.33")				
HM500S	500(19.69")	870(34.25")	670(26.38")	50(1.97")	190(7.48")	250(9.84")	61(2.40")	90(3.54")				
HM400(T-slot)	400(15.75")	870(34.25")	670(26.38")	50(1.97")	160(6.30")	200(7.87")	50(1.97")	110(4.33")				
HM500S(T-slot)	500(19.69")	840(33.07")	640(25.20")	20(0.79")	190(7.48")	250(9.84")	61(2.40")	90(3.54")				

T-slot specification [Opt]

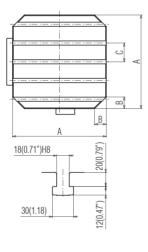

XYZ axes travel diagrams

(935(36.81"))


[(535(21.06"

Front View

(40MG)

(Optional 60MG specification) 3065(120.67")(60MG)[2970(116.93")

2844(111.97") 480(97.64")

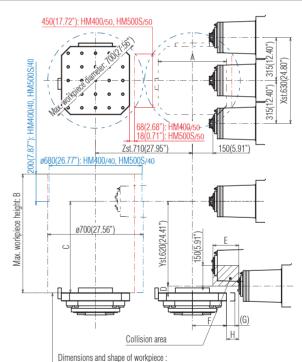

2495(98.23")[2895(113.98")]

3675(144.69")[3680(144.88")]

++++

Blue-colored section: Dimensions and shape for HM400/40 and HM500S/40 Red-colored section: Dimensions and shape for HM400/50 and HM500S/50 Black-colored section: Dimensions and shape being common to the machines

mm(in)

245(9.65") [250(9.84")]

Lift up chip conveyor [Opt]

[]: Dimensions of HM400/50 and HM500S/50


HM Series HM5100/HM6000S

Standard Specifications

Item		HM5100 HM60005				
Travel on X axis (Column: right/left)	mm	800 (31.50")				
Travel on Y axis (Spindle head: up/down)	mm	750 (29.53")				
Travel on Z axis (Table: back/forth)	mm	880 (34.65")				
Distance from table top surface to spindle center	mm	80~830 (3.15"~32.68") 50~800 (1.96"~31.50")				
Distance from table center to spindle nose	mm	70~950 (2.76"~37.40")				
Pallet work surface area	mm	□500 (19.69°) □630 (24.80°)				
Max. weight loadable on pallet	kg	(Uniform load) 800 (1763 lbs) (Uniform load) 700 (1543 lbs)				
Pallet top surface configuration		24×M16tap				
Minimum indexable angle of table	0	BRT 0.001 / IT [Opt] 1*1				
Table index time (for indexing 90 degrees)	sec	BRT 0.5 / IT [Opt] 1.7				
Spindle speed	min ⁻¹	35~12,000				
Number of spindle speed change steps		Electric 2-step speed change (MS)				
Spindle inner taper		7/24 taper, No.50				
Spindle bearing inner diameter	mm	ø100 (3.94")				
Rapid traverse rate	m/min	X,Z: 75 (2,953 ipm) Y: 60 (2,362 ipm)				
Cutting feed rate	mm/min	1~40,000 (0.04~1574 ipm)*₂				
Type of tool shank		JIS B 6339 BT50				
Type of pull stud		OKK only 90°				
Tool storage capacity	tool	60* ³				
Maximum tool diameter	mm	ø115 (4.53") / ø300 (11.81") without tool in adjacent pots				
Maximum tool length (from the gauge line)	mm	600 (23.62")				
Maximum tool weight	kg	When turning at normal speed: 10; When slow turning is selected: 30				
Maximum tool moment	N·m	29.4 (21.68 ft - lbs)				
Tool selection method		Address fixed random system				
Tool change time (cut-to-cut)	sec	3.7 3.6				
Pallet change method		Direct turn				
Pallet change time (JIS evaluation time)	sec	10.5				
Spindle motor (25%ED/30min/cont. rating)	AC, kW	FANUC 45 (60HP) / 30 (40HP) / 26 (35HP)				
Motor for ATC (Automatic Tool Changer)	kW	1.5 (2HP)				
Feed motor (X,Y,Z,B)	kW	FANUC 5.5 (7.4HP) / 5.5 (7.4HP) / 5.5 (7.4HP) / BRT: 4.5 (6.0HP) (IT[Opt]: 1.6 (2.1HP))				
Hydraulic pump motor	kW	1.5 (2HP)				
Motor of oil cooler for spindle and feed system (compression/discharge)	kW	1.1 (1.5HP) / 0.4 (0.5HP)				
Coolant pump motor	kW	50Hz: 0.7 (0.9HP) 60Hz: 1.2 (1.6HP)				
Power supply AC200V±10% 50/60±1Hz AC220V±10% 60±1Hz*4	kVA	FANUC 58				
Compressed air supply	MPa, <i>l</i> /min [ANR]	0.4~0.6* ⁵ , 500* ⁶ (58~87 psi, 132 gal/min)				
Hydraulic unit tank capacity	l	20 (5.3 gal)				
Spindle and feed system cooling oil tank capacity	l	20 (5.3 gal)				
Magazine lubricating oil tank capacity	l	4.2 (0.3 gal)				
Coolant tank capacity	l	720 (190 gal) (Option for the lift up type chip conveyor specification)				
Machine height	mm	4115 (162.01")				
Required floor space	mm	3,655×5,380 (143.90"×211.81") (Option for the lift up type chip conveyor specification)				
Machine weight	kg	15,700 (34,612 lbs) 16,000 (35,273 lbs)				
Operating environment temperature	°C	5~40				

*1 BRT: Built-in rotary table minmum indexing 0.001° IT: Index table minimum indexing 1°
*2 Available under the HQ or hyper HQ control.
*3 The number of stored tools refers a total number of tools including the one installed on the spindle i.e. subtract one from the above for actual number of tools stored in the tool magazine.
*4 When the supply voltage is 220VAC, the supply frequency of 60Hz only is applicable.
*5 Purity of compressed air should be class 3.5.4 or higher class of ISO 8573-1/JIS B8392-1 standard.
*6 Specified is the compressed air supply flow rate for standard specification machines. When optional specifications such as an air blow nozzle are added, add the corresponding air supply requirement.


Machine Dimensions

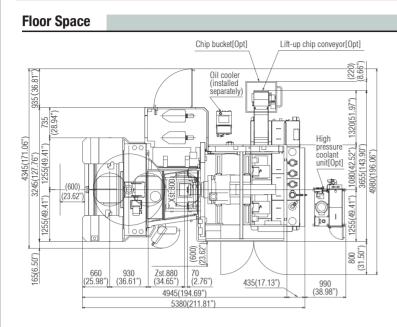


mm(in)



++++

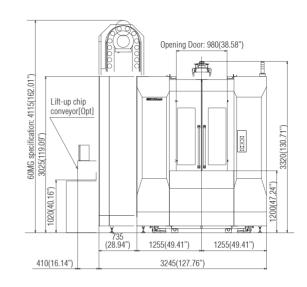

Pallet Dimensions

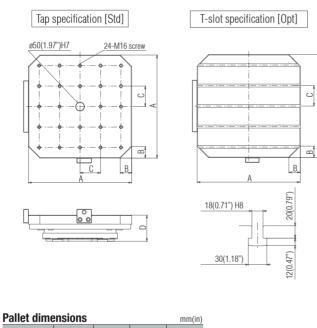


				()				
	A	В	С	D				
HM5100	500(19.69")	60(2.36")	100(3.94")	130(5.12")				
HM6000S	630(24.80")	70(2.76")	125(4.92")	160(6.30")				
Notes: Tap and T-slot are same dimensions								

XYZ axis travel diagrams


XYZ axis travel diagrams mm(in)										
	A B C D									
HM5100	500(19.69")	1330(52.36")	830(32.68")	80(3.15")	271(10.67") ^{*1}					
HM6000S	HM6000S 630(24.8") 1300(51.18") 800(31.5") 50(1.97") 336(13.23									
*1 At B-axis rotated 0°/90°/180°/270°: 250mm (9.84"). *2 At B-axis rotated 0°/90°/180°/270°: 315mm (12.40").										

Notes: Tap and T-slot are same dimensions

Restriction on Tool

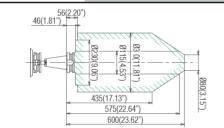

XYZ axes travel diagrams

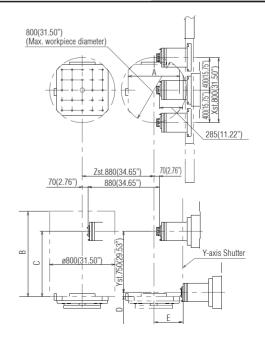

HM Series HM630/HM800S


Standard Specifications

Item		НМБЗО	HM8005				
Travel on X axis (Column: right/left)	mm	1050 (41.34*)					
Travel on Y axis (Spindle head: up/down)	mm	900 (;	35.43")				
Travel on Z axis (Table: back/forth)	mm	900 (35.43")	880 (34.65")				
Distance from pallet top surface to spindle center	mm	80~980 (3.15"~38.58")	60~960 (2.36"~37.80")				
Distance from pallet center to spindle nose	mm	200~1100 (7.87"~43.31")	220~1100 (8.66"~43.31")				
Pallet work surface area	mm	<u>630 (24.80")</u>	□800 (31.50")				
Max. weight loadable on pallet	kg	(Uniform load) 1300 (2866 lbs)	(Uniform load) 1200 (2645 lbs)				
Pallet top surface configuration		24xN	116 tap				
Minimum indexable angle of table	0	BRT 0.001 ,	/ IT [Opt] 1*1				
Table index time (for indexing 90 degrees)	sec	BRT 0.6 /	IT [Opt] 1.7				
Spindle speed	min-1	35~1	2,000				
Number of spindle speed change steps		Electric 2-step s	peed change (MS)				
Spindle inner taper		7/24 tap	per, No.50				
Spindle bearing inner diameter	mm	ø100	(3.94")				
Rapid traverse rate	m/min	54 (2,1	126 ipm)				
Cutting feed rate	mm/min	1~40,000 (0.0)4~1574 ipm)* ²				
Type of tool shank		JIS B 63	339 BT50				
Type of pull stud		ОКК с	only 90°				
Tool storage capacity	tool	4	0*3				
Maximum tool diameter	mm	ø115 (4.53") / ø270 (10.63") without tool in adjacent pots					
Maximum tool length (from the gauge line)	mm	500 (19.69")					
Maximum tool weight	kg	25 (55 lbs)					
Maximum tool moment		29.4 (21	.7 ft · lbs)				
Tool selection method		Address fixed	random system				
Tool change time (cut-to-cut)	Sec	4	1.4				
Pallet change method		Dire	ct turn				
Pallet change time (JIS evaluation time)	Sec	1:	5.0				
spindle motor (25%ED/30min/cont. rating)	AC, kW	FANUC 45 (60HP) / 3	30 (40HP) / 26 (35HP)				
Motor for tool clamp/unclamp unit	kW	0.75 ((1.0HP)				
Feed motor (X, Y, Z, B)	kW	FANUC 5.5 (7.4HP) / 5.5 (7.4HP) / 5.5(7.4HP)	HP) / BRT: 4.5 (6.0HP) (IT[Opt]: 2.7 (3.6HP))				
Hydraulic pump motor	kW	1.5 (2	2.0HP)				
Motor of oil cooler for spindle and feed system (compression/discharge)	kW	1.7(2.3 HP) /	(0.75 (1.0 HP)				
Coolant pump motor	kW	50Hz: 0.7 (0.9HP)) 60Hz: 1.2 (1.6HP)				
Motor for APC unit	kW	0.75 (1.0 HP)				
Power supply 200VAC $\pm 10\%$ 50/60 ± 1 Hz 220VAC $\pm 10\%$ 60 ± 1 Hz ⁴	kVA	FAN	UC 65				
Compressed air supply	MPa, ℓ/min [ANR]	0.4~0.6*5, 500*6 (58	∼87 psi, 132 gal/min)				
Hydraulic unit tank capacity	l	20 (5	.3 gal)				
Spindle and feed system cooling oil tank capacity	l	70 (18	3.5 gal)				
Magazine lubricating oil tank capacity	l	1 (0.3 gal)					
Coolant tank capacity	l	400 (106 gal)					
Machine height	mm	3,430 (135.04")					
Required floor space	mm	3,420x5,450 (134.65"x214.57")					
Machine weight	kg	18,000 (39700 lbs)	18,500 (40800 lbs)				
Operating environment temperature	°C	5-	~40				


*1 BRT: Built-in rotary table minmum indexing 0.001° IT: Index table minimum indexing 1°


*2 Available under the HQ or hyper HQ control.
*3 The number of stored tools refers a total number of tools including the one installed on the spindle i.e. subtract one from the above for actual number of tools stored in the tool magazine.
*4 When the supply voltage is 220VAC, the supply frequency of 60Hz only is applicable.
*5 Purity of compressed air should be class 3.5.4 or higher class of ISO 8573-1/JIS B8392-1 standard.
*6 Specified is the compressed air supply flow rate for standard specification machines. When optional specifications such as an air blow nozzle are added, add the corresponding air supply requirement.

Dimentions

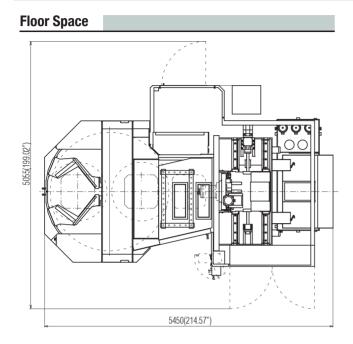


Pallet Dimensions

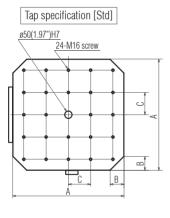

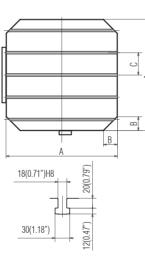

T-slot specification [Opt]



Restriction on Tool

MAX ø270(10.63") with tool in adjacent pot

without tool in adjacent pot

MAX ø115(4.53"

MAX 500(19.69")

1

Pallet dimensions mm(ir										
	A	В	С	D						
HM630	630(24.8")	70(2.76")	125(4.92	160(6.30")						
HM800S	800(31.5")	100(3.94")	160(6.30")	180(7.09")						
HM800S(T-slot)	800(31.50")	100(3.94")	160(6.30")	200(7.87")						
IMOOD T IT I I I I										

HM630: Tap and T-slot are same dimensions.


al di .

XYZ axis travel diagrams													mm(in)	
		А	В	С	D	E	F	G	Н	1	J	K	L	М
	HM630	630(24.8")	200(7.87")	900(35.43")	900(35.43")	200(7.87")	1220(48.03")	980(38.58")	80(3.15")	220(8.66")	315(12.4")	84(3.31")	105(4.13")	150(5.91")
	HM800S	800(31.5")	220(8.66")	880(34.65")	880(34.65")	220(8.66")	1200(47.24")	960(37.80")	60(2.36")	300(11.81")	400(15.75")	100(3.94")	120(4.72")	150(5.91")
	HM800S(T-slot)	800(31.50")	220(8.66")	880(34.65")	880(34.65")	220(8.66")	1180(46.46")	940(37.01")	40(1.57")	300(11.81")	400(15.75")	100(3.94")	120(4.72")	170(6.69")
	HM630: Tan and 1	E-slot are same o	limensions											

MAX ø230(9.06")

MIN 46(1.81") MIN 56(2.20")


mm(in)

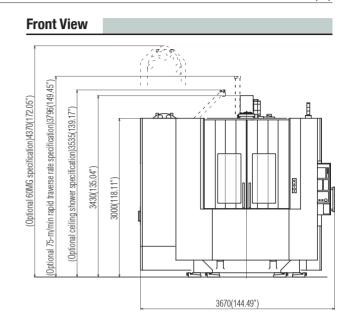

+++

XYZ axes travel diagrams

(Note 1) For executing the APC operation, the loaded workpiece must not exceed the specified maximum APC turning diameter.

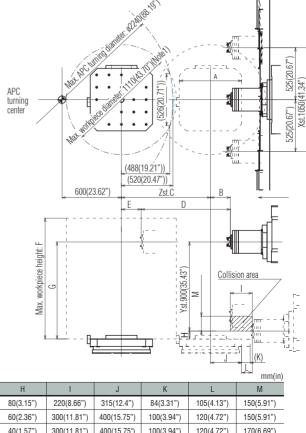

HM Series HM800/HM1000S


Standard Specifications

Item		HM800	HMIOOOS					
Travel on X axis (Column: right/left)	mm	1400 (55.12")						
Travel on Y axis (Spindle head: up/down)	mm	1100 (43.31")						
Travel on Z axis (Table: back/forth)	mm	1050 (41.34")	1000 (39.37")					
Distance from pallet top surface to spindle center	mm	60~1160 (2.36"~45.67")	30~1130 (1.18"~44.49")					
Distance from pallet center to spindle nose	mm	200~1250 (7.87"~49.21")	250~1250 (9.84"~49.21")					
Pallet work surface area	mm	800 (31.50 ")	□ 1000 (39.37")					
Max. weight loadable on pallet	kg	(Uniform load) 2000 (4400 lbs)	(Uniform load) 2500 (5500 lbs)					
Pallet top surface configuration		24xM	16 tap					
Minimum indexable angle of table	0	IT 1/ BRT [I	Opt] 0.001*1					
Table index time (for indexing 90 degrees)	sec	IT 4.5 / BRT [Opt] 1.2	IT 5.5 / BRT [Opt] 1.2					
Spindle speed	min ⁻¹	35~8	,000					
Number of spindle speed change steps		Electric 2-step sp	eed change (MS)					
Spindle inner taper		7/24 tapa	er, No.50					
Spindle bearing inner diameter	mm	ø100 (3.94")					
Rapid traverse rate	m/min	48 (1,8	39 ipm)					
Cutting feed rate	mm/min	1~40,000 (0.0	4~1574 ipm)*2					
Type of tool shank		JIS B 63	39 BT50					
Type of pull stud		ОКК о	nly 90°					
Tool storage capacity	tool	40	*3					
Maximum tool diameter	mm	ø115 (4.53") / ø270 (10.63") without tool in adjacent pots						
Maximum tool length (from the gauge line)	mm	500 (19.69")						
Maximum tool weight	kg	25 (5)	5 lbs)					
Maximum tool moment		29.4 (21.7 ft - lbs)						
Tool selection method		Address fixed random system						
Tool change time (cut-to-cut)	sec	5.	8					
Pallet change method		Direc	t turn					
Pallet change time (JIS evaluation time)	sec	19.0	21.0					
spindle motor (30min/cont. rating)	AC, kW	FANUC 30 (40F	IP) / 25 (34HP)					
Motor for tool clamp/unclamp unit	kW	0.75 (1	I.0HP)					
Feed motor (X, Y, Z, B)	kW	FANUC 5.5 (7.4HP) / 9.0 (12.1HP) / 6.0 (8.0	HP) / IT: 2.7 (3.6HP) (BRT[Opt]: 4.5 (6.0HP))					
Hydraulic pump motor	kW	1.5 (2.0HP)						
Motor of oil cooler for spindle and feed system (compression/discharge)	kW	1.7 (2.3HP) /	0.75 (1.0HP)					
Coolant pump motor	kW	50Hz: 0.7 (0.9HP)	60Hz: 1.2 (1.6HP)					
Motor for APC unit	kW	0.75 (1	I.0HP)					
Power supply 200VAC ±10% 50/60 ±1Hz 220VAC ±10% 60 ±1Hz'4	kVA	FANL	IC 61					
Compressed air supply	Pa, ℓ/min [ANR]	0.4~0.6*5, 500*6 (58-	-87 psi, 132 gal/min)					
Hydraulic unit tank capacity	l	20 (5.	3 gal)					
Spindle and feed system cooling oil tank capacity	l	72 (1	9 gal)					
Magazine lubricating oil tank capacity	l	1 (0.3	3 gal)					
Coolant tank capacity	l	800 (2	11 gal)					
Machine height	mm	4,000 (1	57.48")					
Required floor space	mm	3,682x6,395 (14	14.96"x251.77")					
Machine weight	kg	24,500 (54,000 lbs)	25,000 (55,000 lbs)					
Operating environment temperature		5~	-40					

*1 BRT: Built-in rotary table minmum indexing 0.001° IT: Index table minimum indexing 1°

*2 Available under the HQ or hyper HQ control.
*3 The number of stored tools refers a total number of tools including the one installed on the spindle i.e. subtract one from the above for actual number of tools stored in the tool magazine.
*4 When the supply voltage is 220VAC, the supply frequency of 60Hz only is applicable.
*5 Purity of compressed air should be class 3.5.4 or higher class of ISO 8573-1/JIS B8392-1 standard.
*6 Specified is the compressed air supply flow rate for standard specification machines. When optional specifications such as an air blow nozzle are added, add the corresponding air supply requirement.


Dimentions

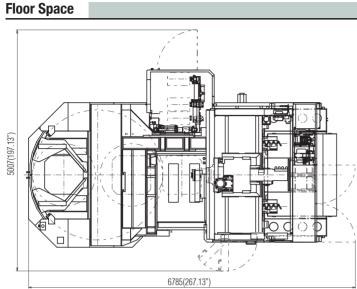

(Optional 60MG specification)4335(170.67") 1000(157.48") 3200(125.98") 0.0.1 \cup

+++

Pallet Dimensions

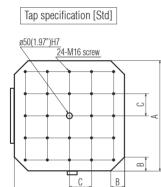



Pallet dimensions

	A	В	С	D
HM800	800(31.5")	100(3.94")	160(6.30")	174(6.85")
HM1000S	1000(39.37")	125(4.92")	200(7.87")	204(8.03")
HM800(T-slot)	800(31.5")	100(3.94")	160(6.30")	204(8.03")
HM1000S(T-slot)	1000(39.37")	125(4.92")	200(7.87")	214(8.43")


mm(in)

XYZ axis travel diagrams

Г	
	5
	_
B	
A	
18(0.71")H8 18(0.71")H8	
50 1 1000	
<u>175</u> (0.47 ¹¹)	
<u>00(1.10)</u> + + (7)	
Ň	

T-slot specification [Opt]

Restriction on Tool






Front View

XYZ axes travel diagrams

(Note1) For executing the APC operation, the loaded workpiece must not exceed the specified maximum APC turning diameter.

3682(144.96")

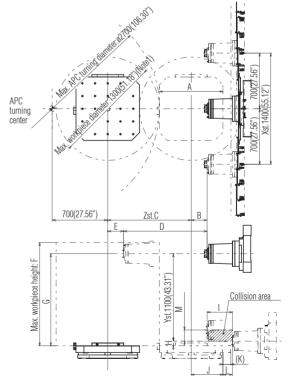

													mm(in)
	А	В	С	D	E	F	G	Н	I	J	К	L	М
HM800	800(31.5")	200(7.87")	1050(41.34")	1050(41.34")	200(7.87")	1300(51.18")	1160(45.67")	60(2.36")	320(12.6")	400(15.75")	100(3.94")	120(4.72")	140(5.51")
HM1000S	1000(39.37")	250(9.84")	1000(39.37")	1000(39.37")	250(9.84")	1270(50.00")	1130(44.49")	30(1.18")	400(15.75")	500(19.69")	125(4.92")	150(5.91")	140(5.51")
HM800(T-slot)	800(31.5")	200(7.87")	1050(41.34")	1050(41.34")	200(7.87")	1270(50.00")	1130(44.49")	30(1.18")	320(12.6")	400(15.75")	100(3.94")	120(4.72")	140(5.51")
HM1000S(T-slot)	1000(39.37")	250(9.84")	1000(39.37")	1000(39.37")	250(9.84")	1260(49.61")	1120(44.09")	20(0.79")	400(15.75")	500(19.69")	125(4.92")	150(5.91")	150(5.91")

mm(in)

HM Series HM1000/HM1250S

Standard Specifications

Item		HMIOOO	HMI2505					
Travel on X axis (Column: right/left)	mm	mm 1700 (66.93")						
Travel on Y axis (Spindle head: up/down)	mm	1400	(55.12")					
Travel on Z axis (Table: back/forth)	mm	1400 (55.12")	1240 (48.82")					
Distance from pallet top surface to spindle center	mm	100~1500 (3.94"~59.06")	70~1470 (2.76"~57.87")					
Distance from pallet center to spindle nose	mm	200~1600 (7.87"~62.99")	360~1600 (14.17"~62.99")					
Pallet work surface area	mm	□ 1000 (39.37")	1250 (49.21")					
Max. weight loadable on pallet	kg) 3000 (6600 lbs)						
Pallet top surface configuration		24xM16 tap	24xM20 tap					
Minimum indexable angle of table	0	IT 1/ BRT	[Opt] 0.0001*1					
Table index time (for indexing 90 degrees)	sec	IT 5.0 / E	3RT [Opt] 1.8					
Spindle speed	min ⁻¹	35-	-12,000					
Number of spindle speed change steps		Electric 2-step	speed change (MS)					
Spindle inner taper		7/24 ta	aper, No.50					
Spindle bearing inner diameter	mm	ø100	0 (3.94")					
Rapid traverse rate	m/min	48 (1	,889 ipm)					
Cutting feed rate	mm/min	1~20,000 (0	0.04~787 ipm)*2					
Type of tool shank		JIS B (6339 BT50					
Type of pull stud		ОКК	OKK only 90°					
Fool storage capacity	tool		40*3					
Maximum tool diameter	mm	ø115 (4.53") / ø270 (10.63") without tool in adjacent pots						
Maximum tool length (from the gauge line)	mm	600 (23.62")						
Maximum tool weight	kg	25 (55 lbs)						
Maximum tool moment	N⋅m	29.4 (21.7 ft · lbs)						
Fool selection method		Address fixed random system						
Tool change time (cut-to-cut)	sec		6.2					
Pallet change method		Dir	ect turn					
Pallet change time (JIS evaluation time)	sec	32.0	35.0					
spindle motor (30min/cont. rating)	AC, kW	FANUC 30 (4	OHP) / 25 (34HP)					
Notor for tool clamp/unclamp unit	kW	0.75	(1.0HP)					
Feed motor (X, Y, Z, B)	kW	FANUC 5.0 (6.7HP) / 5.5x2 (7.4x2HP) / 5.0x2 ((6.7x2HP) / IT: 3.0 (4.0HP) (BRT[Opt]: 5.5 (7.4HP))					
Hydraulic pump motor	kW	2.2	(3.0HP)					
Motor of oil cooler for spindle and feed system (compression/discharge)	kW	1.7 (2.3HP) /	0.75x2 (1.0x2HP)					
Coolant pump motor	kW	50Hz: 0.7 (0.9H	P) 60Hz: 1.2 (1.6HP)					
Motor for APC unit	kW	FANUC]:	1.2 (1.6HP)					
Power supply 200VAC ±10% 50/60 ±1Hz 220VAC ±10% 60 ±1Hz*4	kVA		NUC 72					
Compressed air supply	MPa, ℓ/min [ANR]	0.4~0.6*5, 500*6 (58~87 psi, 132 gal/min)						
Hydraulic unit tank capacity	l	20 (5.3 gal)					
Spindle and feed system cooling oil tank capacity	l	70x2 (*	18.5x2 gal)					
Magazine lubricating oil tank capacity	l	4 (1.1 gal)					
Coolant tank capacity	l		(211 gal)					
Machine height	mm		(146.34")					
Required floor space	mm		217.72"x322.64")					
Machine weight	kg	31,000 (68,400 lbs)	32,500 (72,000 lbs)					
Operating environment temperature	°C		5~40					


*1 BRT. Built-in rotary table minmum indexing 0.001° IT: Index table minimum indexing 1°
 *2 Available under the HQ or hyper HQ control.
 *3 The number of stored tools refers a total number of tools including the one installed on the spindle i.e. subtract one from the above for actual number of tools stored in the tool magazine.

*4 When the supply voltage is 220VAC, the supply frequency of 60Hz only is applicable.
*5 Purity of compressed air should be class 3.5.4 or higher class of ISO 8573-1/JIS B8392-1 standard.
*6 Specified is the compressed air supply flow rate for standard specification machines. When optional specifications such as an air blow nozzle are added, add the corresponding air supply requirement.

Dimentions

Floor Space \overline{X} 5950(234.25") Q 8195(322.64")

Front View

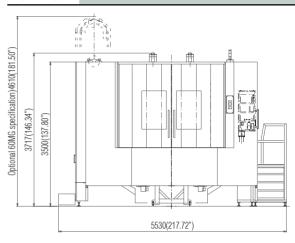


mm(in)

+++

XYZ axes travel diagrams

(Note1) For executing the APC operation, the loaded workpiece must not exceed the specified maximum APC turning diameter.

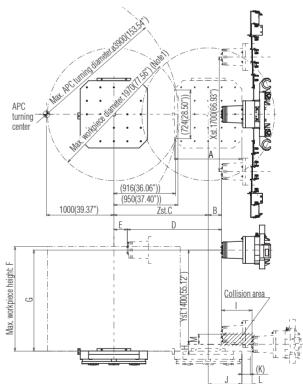

HM1250S(T-slot) 1250(49.21") 125(4.92") 250(9.84") 258(10.16")

Pallet dimensions

HM1000(T-slot) 1000(39.37")

HM1000

HM1250S

XYZ	axis	travel	diagrams
-----	------	--------	----------

А

В

1000 (39.37") 125(4.92") 200(7.87") 208(8.19")

1250(49.21") 125(4.92") 250(9.84") 238(9.37")

XYZ axis tr	ravel diagr	ams			magazines, the maximum tool length shall be limited to 500mm (19.69") mmm(in)								
	А	В	С	D	E	F	G	Н		J	K	L	М
HM1000	1000(39.37")	200(7.87")	1400(55.12")	1400(55.12")	200(7.87")	1550(61.02")	1500(59.06")	100(3.94")	450(17.72")	500(19.69")	125(4.92")	150(5.91")	150(5.91")
HM1000(T-slot)	1000(39.37")	200(7.87")	1400(55.12")	1400(55.12")	200(7.87")	1520(59.84")	1470(57.87")	70(2.76")	450(17.72")	500(19.69")	125(4.92")	150(5.91")	180(7.09")
HM1250S	1250(49.21")	360(14.17")	1240(48.82")	1240(48.82")	360(14.17")	1520(59.84")	1470(57.87")	70(2.76")	470(18.50")	625(24.61")	175.4(6.91")	205(8.07")	180(7.09")
HM1250S(T-slot)	1250(49.21")	360(14.17")	1240(48.82")	1240(48.82")	360(14.17")	1500(59.06")	1450(57.09")	50(1.97")	470(18.50")	625(24.61")	175.4(6.91")	205(8.07")	180(7.09")

MAX ø230(9.06")

MIN 46(1.81") MIN 56(2.20")

5∍

(Note2) When three or more multiple magazines, 600mm (23.62") (Index 2)

are usable in the first and second magazines only. In the 3rd or the following

ပ

В

79")

20(0.

12(0.47")

18(0.71")H8

30(1.18")

MAX ø270(10.63")

in adjacent pot

without tool in adjacent pot

with tool

mm(in)

D

С


125(4.92") 200(7.87") 238(9.37")


Restriction on Tool

MAX

ø115(4.53")

Pallet Dimensions

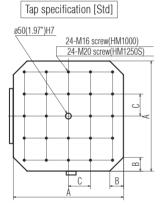




T-slot specification [Opt]



65 Union Ave Sudbury, MA 01776 (877) 783-6800 sales@methodsmachine.com www.methodsmachine.com

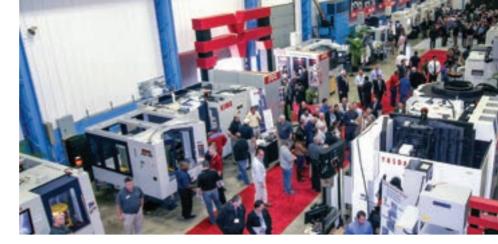

Founded in 1958, with three employees and a few refurbished machines, Methods Machine Tools, Inc. has grown into one of the largest, most innovative precision machine tools importers in North America. With over 300 employees, eight sales and technology centers, and over 40,000 machines installed throughout the United States, Canada and Mexico, Methods supplies leading-edge precision machine tools and solutions. The founder Mr. Clement McIver, Sr., established principles from the company's beginning that continue to set Methods apart from conventional importers or distributors. "Anyone can sell a machine," said the company's late founder, "but not everyone provides the extra effort that makes a difference in the company's bottom line."



Methods - Boston 65 Union Ave Sudbury, MA 01776 (978) 443-5388



Methods - Charlotte* 13607 South Point Boulevard Charlotte, NC 28273 (704) 587-0507



Methods - Chicago 2400 Vantage Drive Elgin, IL 60124 (847) 783-6800



Methods - Detroit 50531 Varsity Court Wixom, MI 48393 (248) 624-8601



Methods - Los Angeles 1980 West Corporate Way Anaheim, CA 92801 (714) 521-2507



Methods - Memphis* 6700 Fletcher Creek Cove Memphis, TN 38133 (901) 255-6760



Methods - Phoenix 615 West 24th Street Tempe, AZ 85282 (602) 437-2220



Methods - San Francisco 650 Whitney Street San Leandro, CA 94577 (510) 636-1430